

FAX RECEIVED

SEP 25 2006

Untitled

OFFICE OF PETITIONS

Petitions for Revival office.

In response to application #10796490 i have sent in the petition for revival and power of attorney form because my patent attorney let my patent go abandoned unintentionally. I would like to add to my petition the response or action items that were needed by the examiner to see my serious intentions of continuing this patent application. You should have already recieved payment of 750.00. If you have any more questions or concerns or anything else i need to do to keep this patent active please contact me asap.

Sincerely,

Mark A. Lykam
p.o. box 331
chelmsford, ma 01824

978 642 2094
408 427 1204
408 655 7253

ATT:

ANDREA SMITH

FROM


MARK LYKAM

978-642-2094

571-273-0025

CLAIM # 2 (RESPONSE)

NOTE: LH/PH TOPSID FINGERS []
PURPOSE IS TO PUSH PILLS BACK INTO "V" GROOVE ON BOTTOM SIDE
OF INDEXING WHEEL [] THIS LOCATES & CENTERS PILL FOR CUTTING.

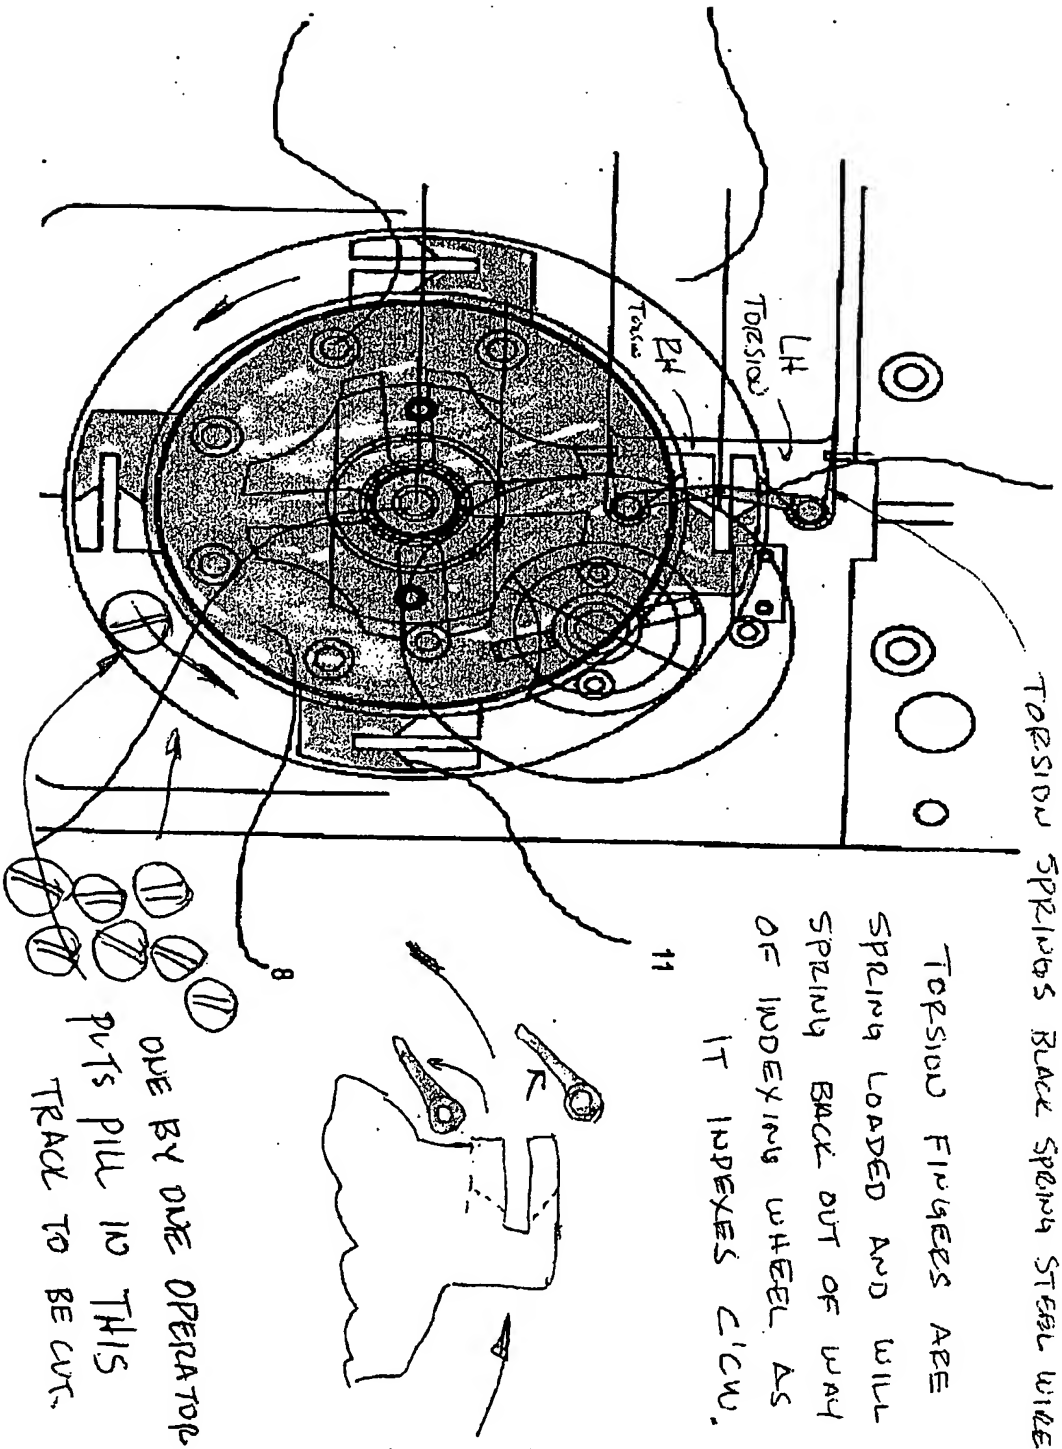

CONT.

INDEXING WHEEL [] ROTATES (INDEXES) BY GEAR MECHANISM &
ELECTRIC MOTOR WHICH IS LOCATED AT BOTTOM SIDE OF INDEXING WHEEL.
INDEXING WHEEL TRAVELS COUNTER CLOCKWISE @ A RATE OF OVER


CLAIM # 3 (RESPONSE)

SHEET 1 ILLUSTRATION

TORSION FINGERS
REACT TO ADJUST
BY MOVING BACK
OR FORTH DEPENDING
ON PILL SIZE SHOWN

TORSION FINGERS WILL
SPRING BACK AS
INDEXING WHEEL PASSES
PAST THEM THEN RETURN
TO NORMAL RESTING
POSITION.

MACHINE SHOWN CLAMPING
.500 DIA. X .187 THICK PILL

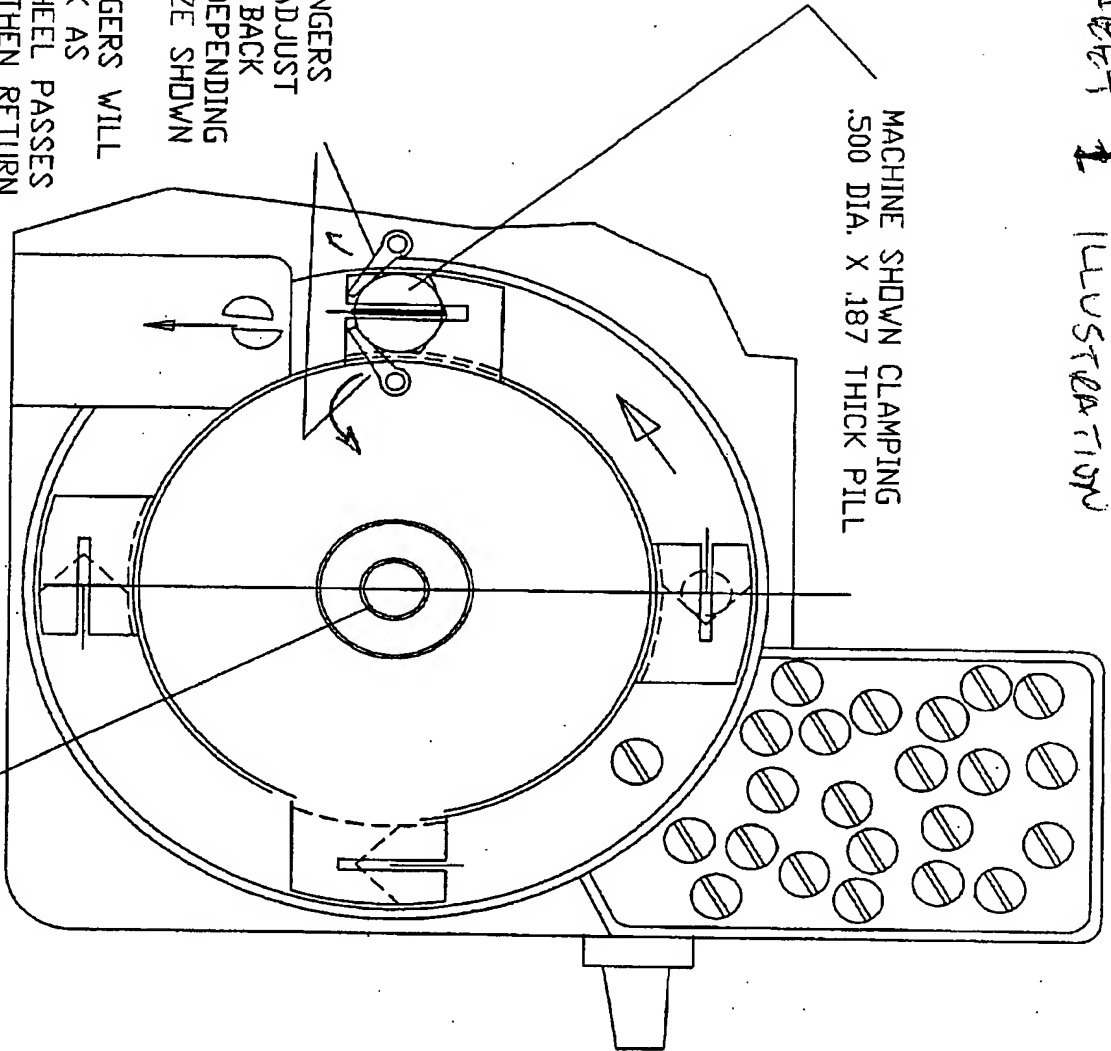


THUMB SCREW ADJUST
TIMING OF INDEXING WHEEL.
LOOSEN THEN MOVE THAN TIGHTEN AGAIN

CLAIM #3 (RESPONSE)


SHEET #2

THE INDEXING WHEEL PASSES IN THE PATH OF THE LN/RH TORSION FINGER & AUTOMATICALLY PUSHES TORSION FINGER BACK OUT OF THE WAY ALLOWING INDEXING WHEEL TO CONTINUE TO ROTATE THROUGH. THIS ALLOWS THE PILL TO CONTINUE THRU THE MACHINE AFTER IT IS CUT IN HALF

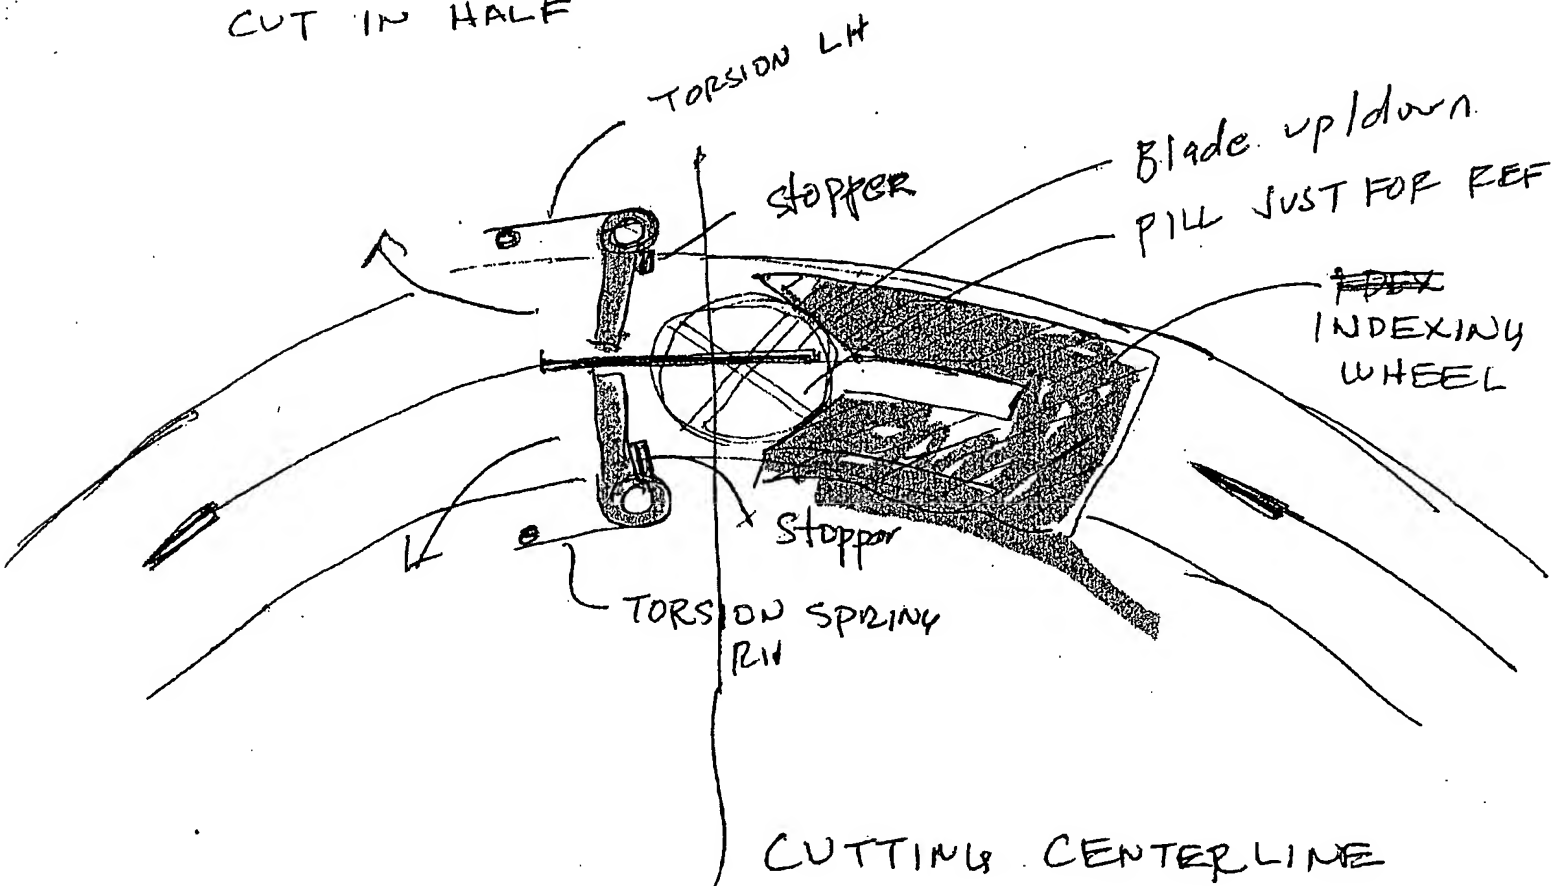

CLAIM # 4 (RESPONSE)

OPERATOR SLIDES ONE PILL INTO PILL TRACK AT ~~EACH~~ EACH INDEXING SEQUENCE. THE INDEXING WHEEL INDEXES AND MAKES CONTACT WITH PILL. THE PILL FALLS BACK INTO "V" GROOVE SHOWN ON BOTTOM SIDE IN HIDDEN LINES. THE INDEXER MOVES PILL TO CUTTER POSITION. BECAUSE THE PILL IS UNDER THE PLASTIC INDEXING WHEEL & THE ENABLE THE BLADE TO PASS THRU THE PILL AND COME BACK UP WITHOUT THE PILL COMING WITH THE BLA INDEXING WHEEL ACTS AS A STRIPPER PLATE AND POSITIONER.

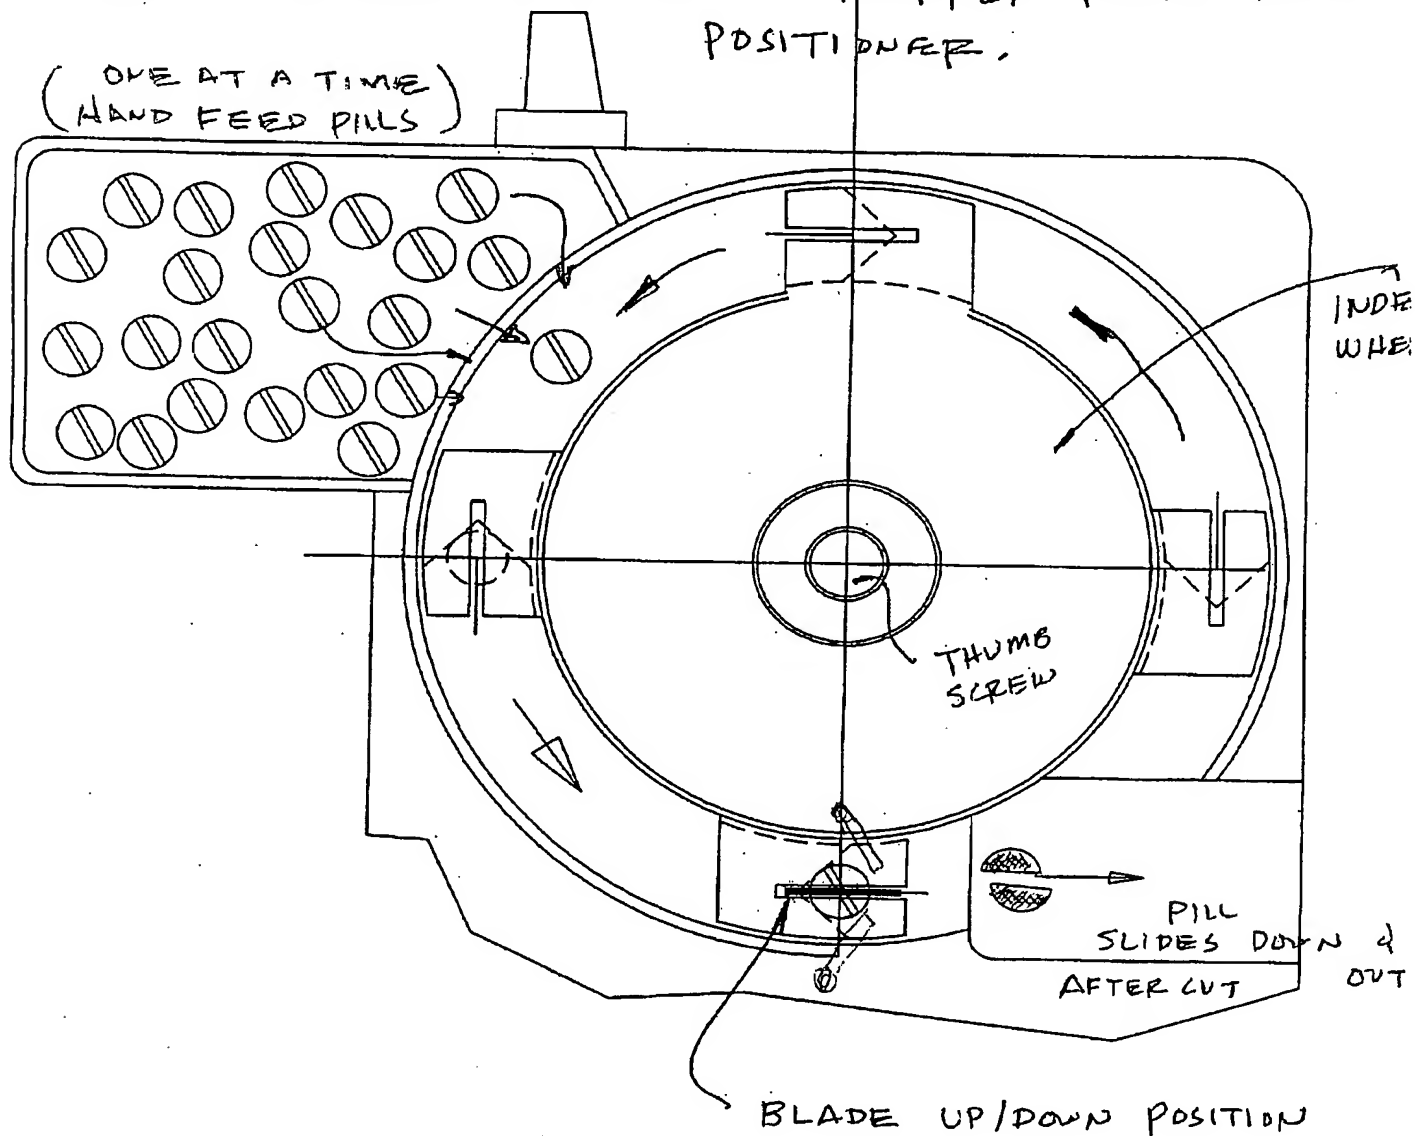


NOTE:


NO CHANGE OVER REQUIRED
SAME WHEEL

CLAIM #5 (RESPONSE)
ILLUSTRATES HOW THE INDEXING
WHEEL HAS TO BE RETARDED OR
ADVANCED DEPENDING ON PILL SIZE
OF DIAMETER. INDEXING WHEEL IS RETARDED
FOR LARGER DIAMETERS AND ADVANCED FOR
SMALLER DIAMETERS AS SHOWN.
TO MAKE THIS ADJUSTMENT JUST USE THUMB
SCREW IN MIDDLE OF WHEEL LOOSEN TO MAKE
BOTH ADJUSTMENTS THEN JUST TIGHTEN WHEN
PILL IS CENTERED UNDER THE CUTTING BLADE

MACHINE SHOWN CLAMPING
.500 DIA. X .187 THICK PILL

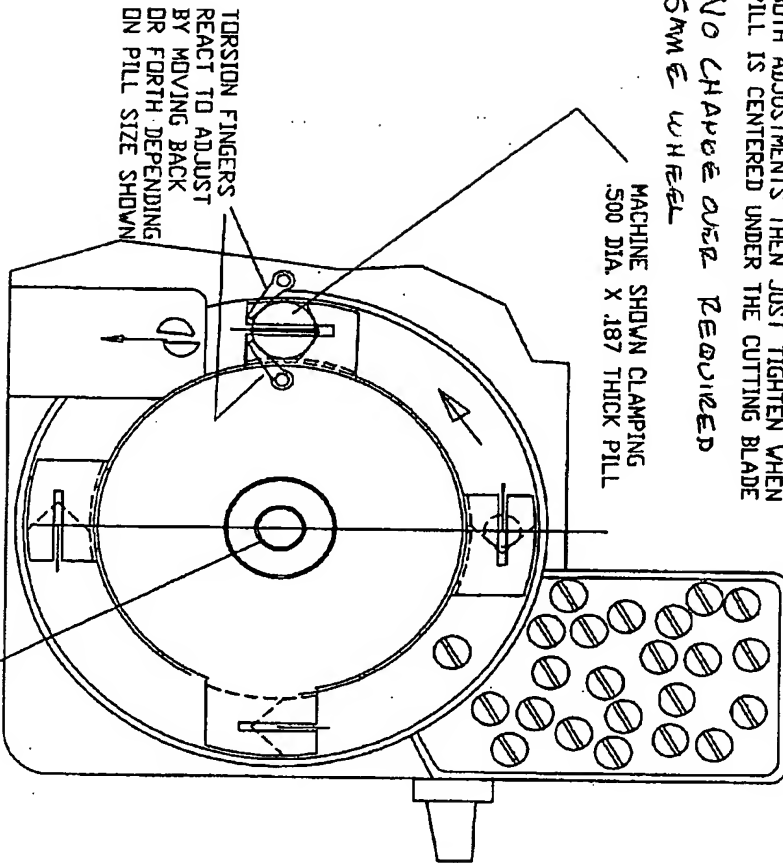


MACHINE SHOWN CLAMPING
.187 DIA. X .187 THICK PILL

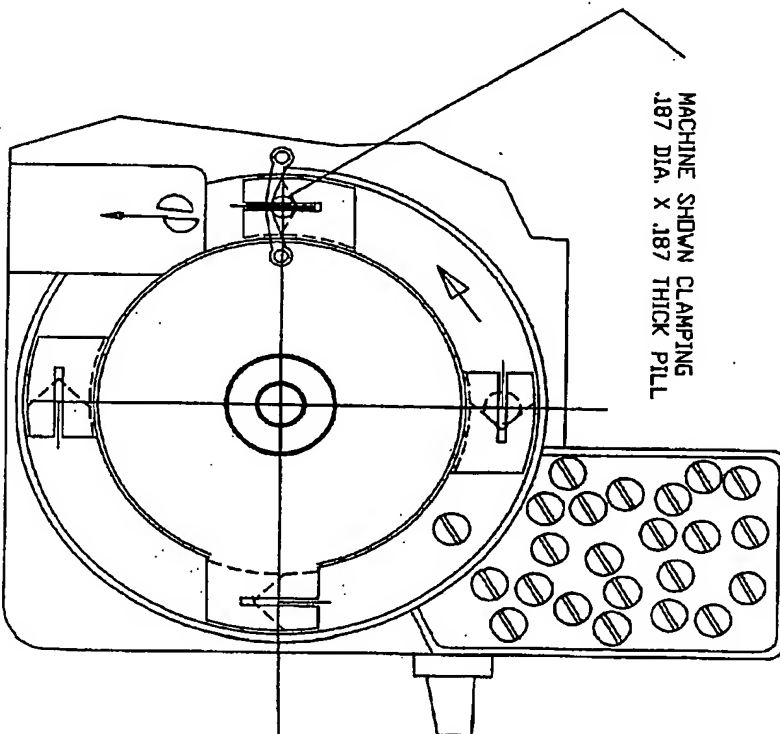


CLAIM #5 (RESPONSE)
ILLUSTRATIONS

THIS SHOWS INDEXING WHEEL
RECONFIGURED (MACHINED)
DIFFERENTLY THAN "Y" GROOVE
TO HANDLE OBLONG OVAL
SHAPED PILLS.

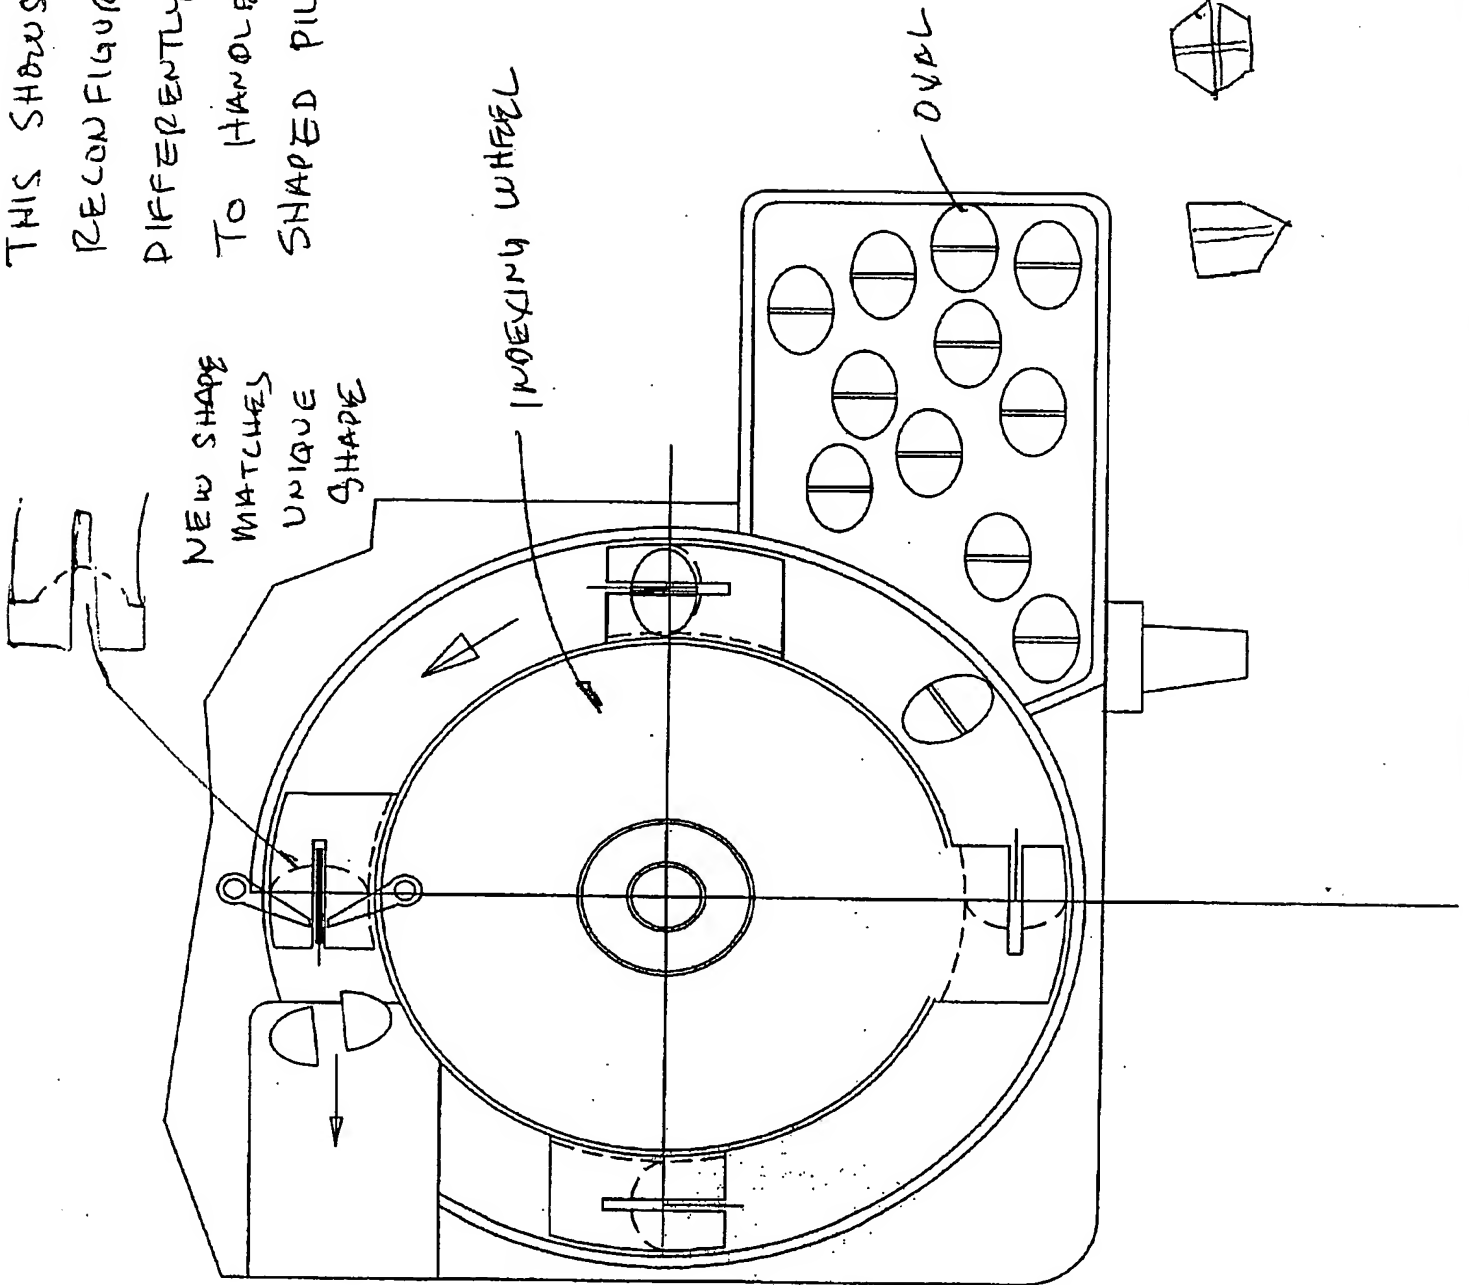


CLAIM #7
(RESPONSE)


ELECTRIC CURRENT IS APPLIED TO SOLENOID ITEM #1 CAUSES PLUNGER TO MOVE DOWNWARD CREATING 16 POUNDS OF CUTTING FORCE. BLADE #6 ITEM IS ATTACHED TO A SPRING LOADED SLIDE #4 WHICH ALLOWS IT TO SPRING UPWARD AFTER SOLENOID IS DEGENERIZED OR POWER IS REVERSED.

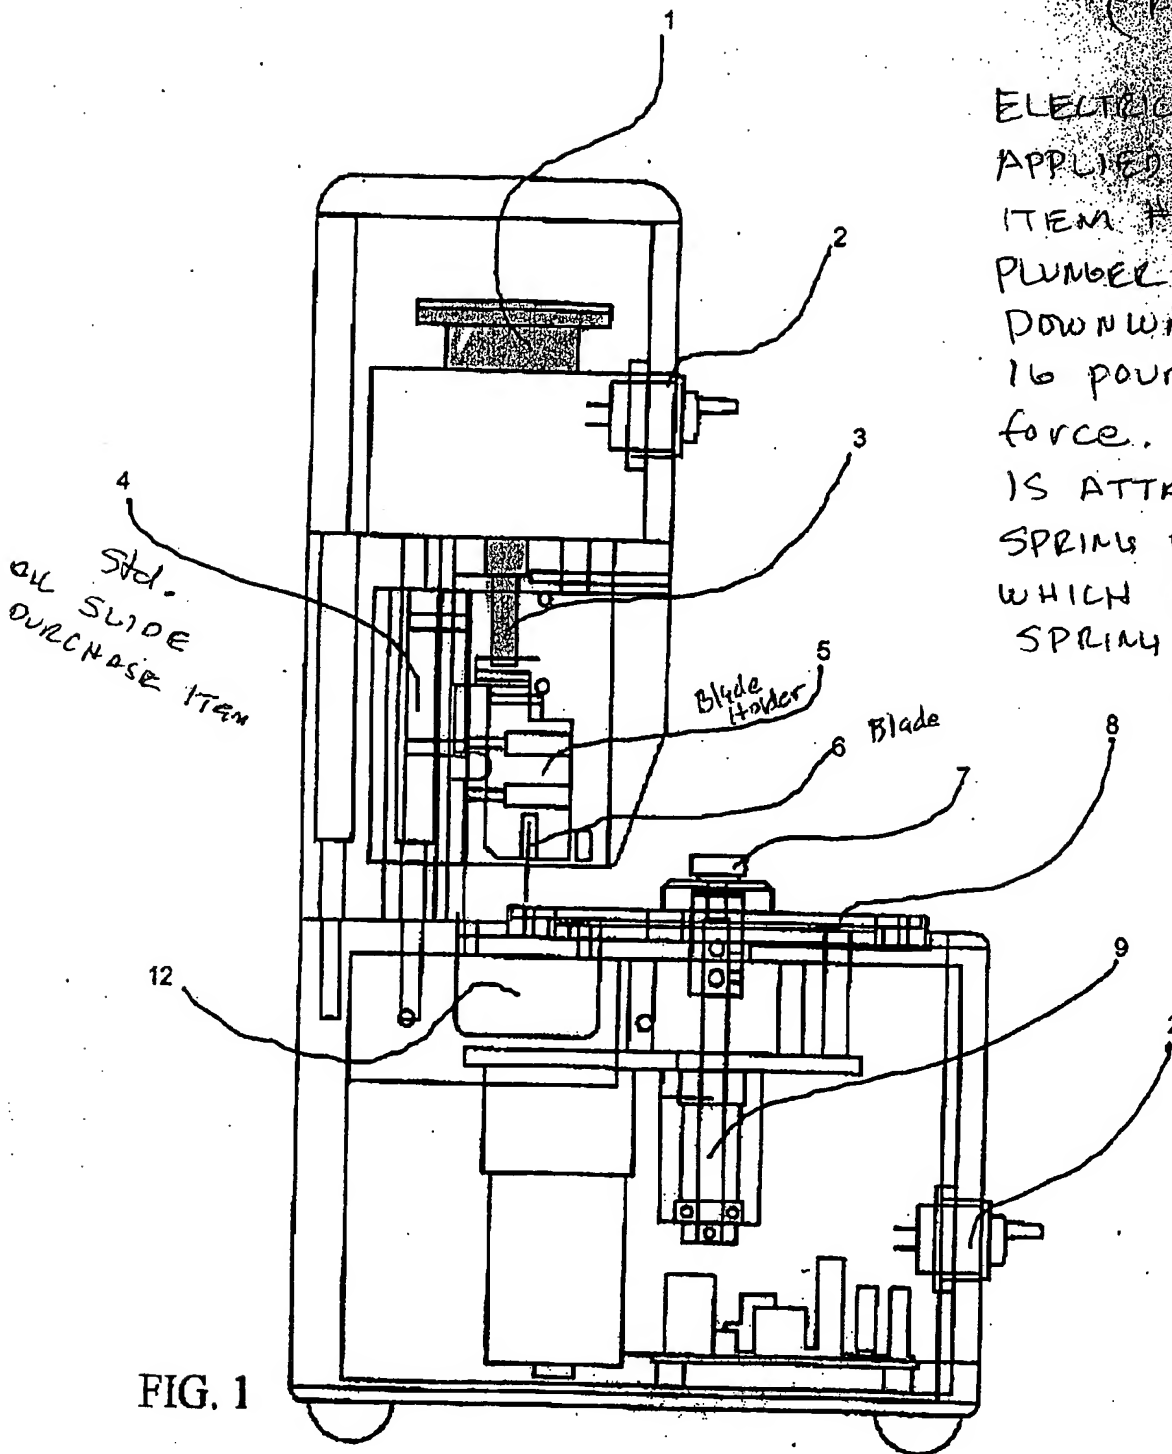

CLAIM #8 (RESPONSE)

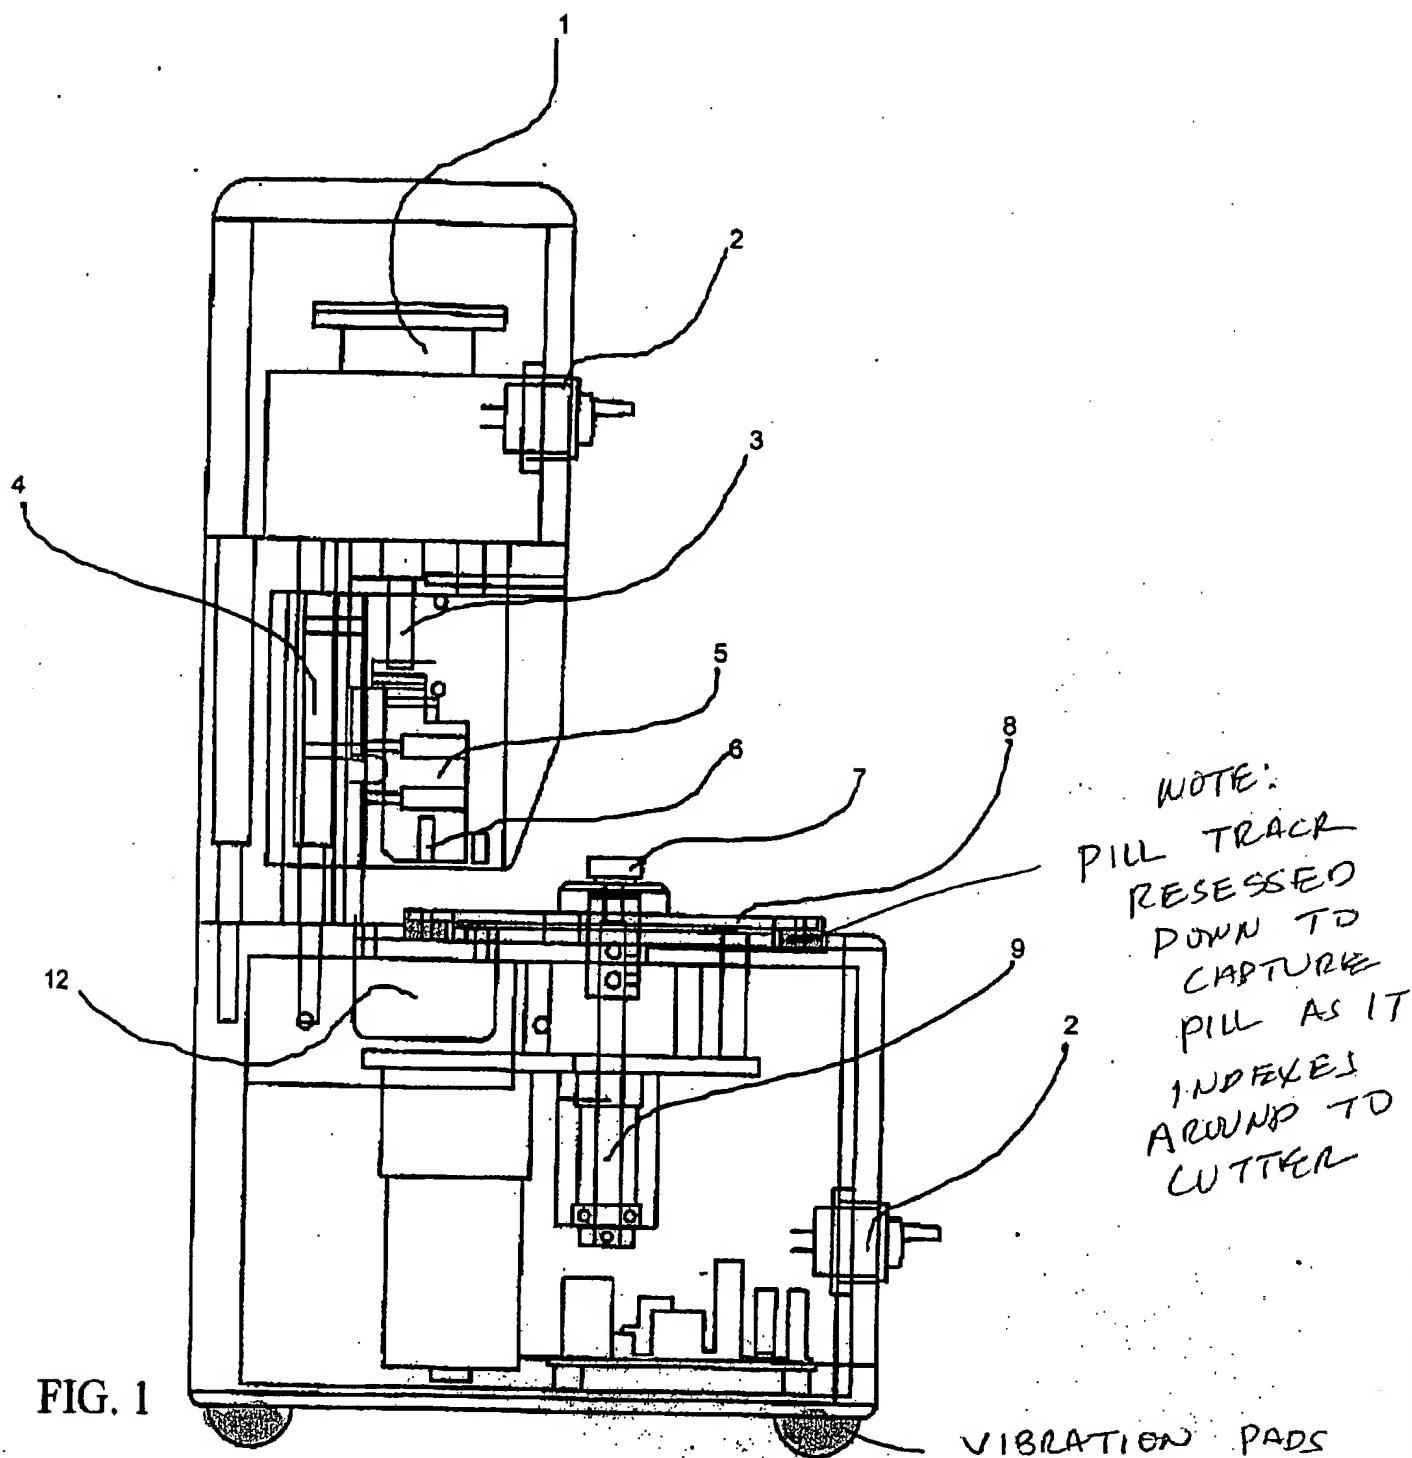

WITHOUT VIBRATION PADS THE PILL WILL JUMP AROUND IN PILL TRACK AND POSSIBLY ROTATE TO MUCH TO BE CENTERED LOCATION AT CUTTING POSITION,

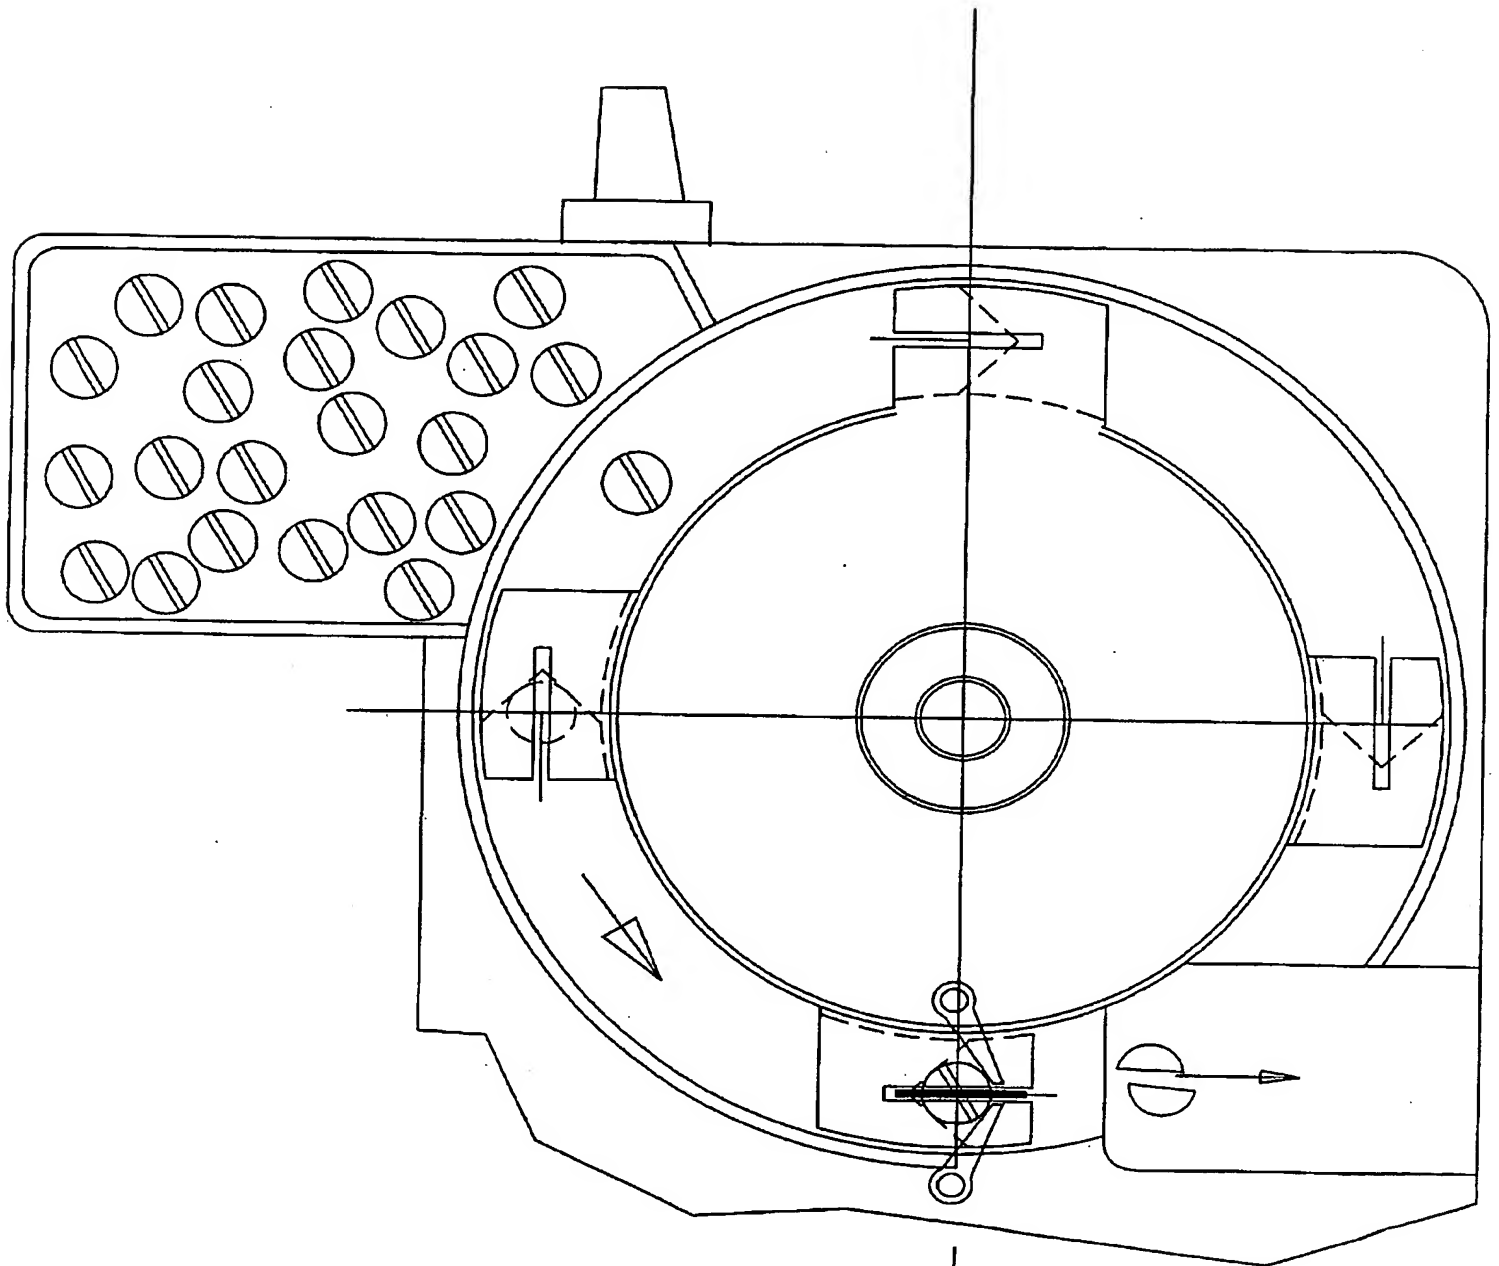



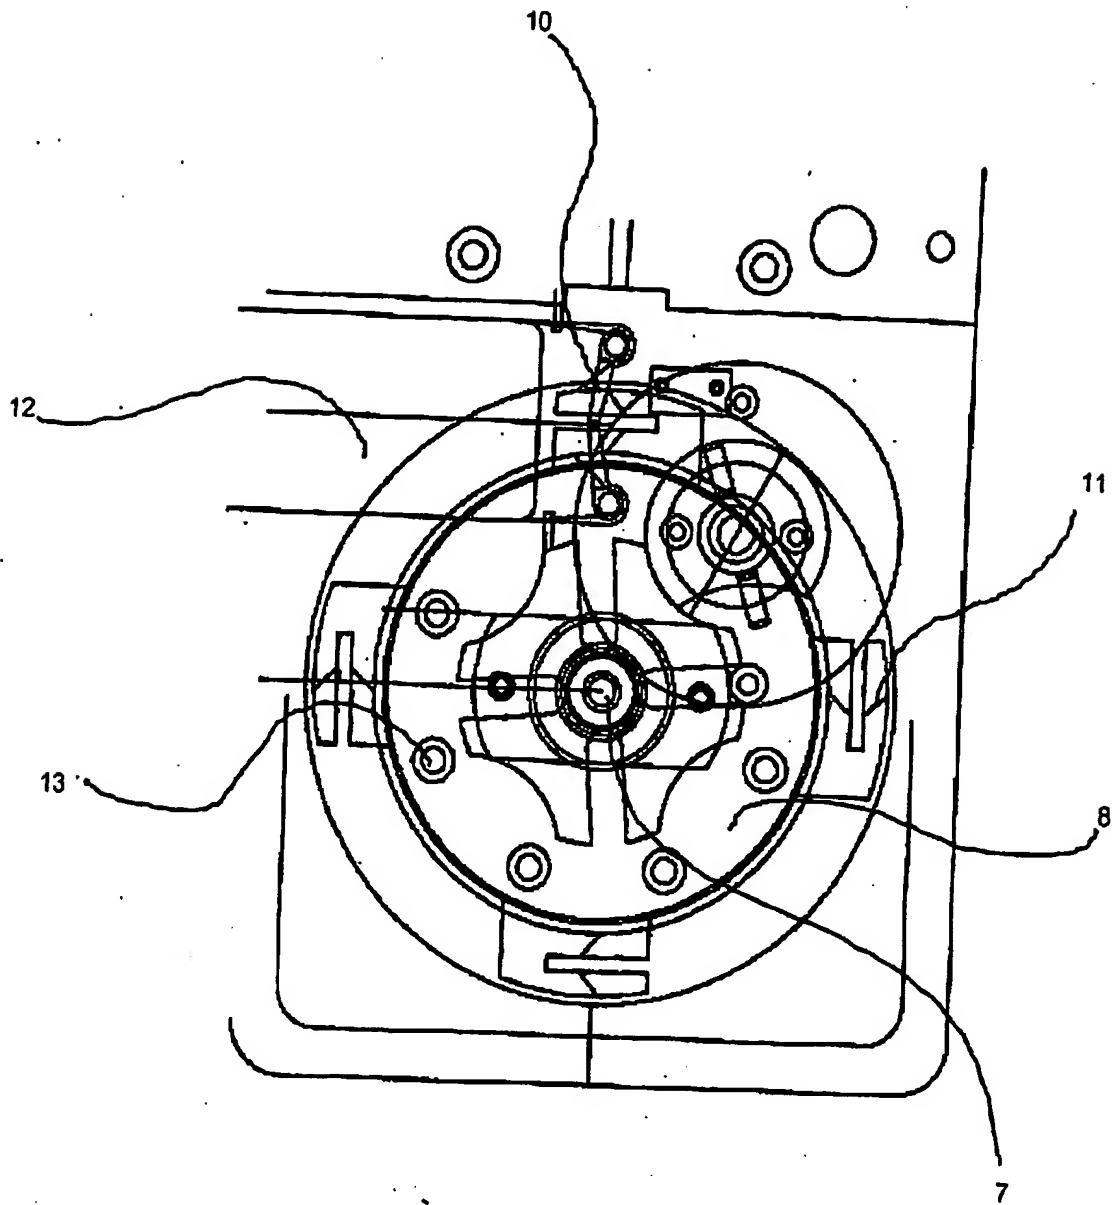


FIG. 2


MACHINE SHOWN CLAMPING
.187 DIA. X .187 THICK PILL.

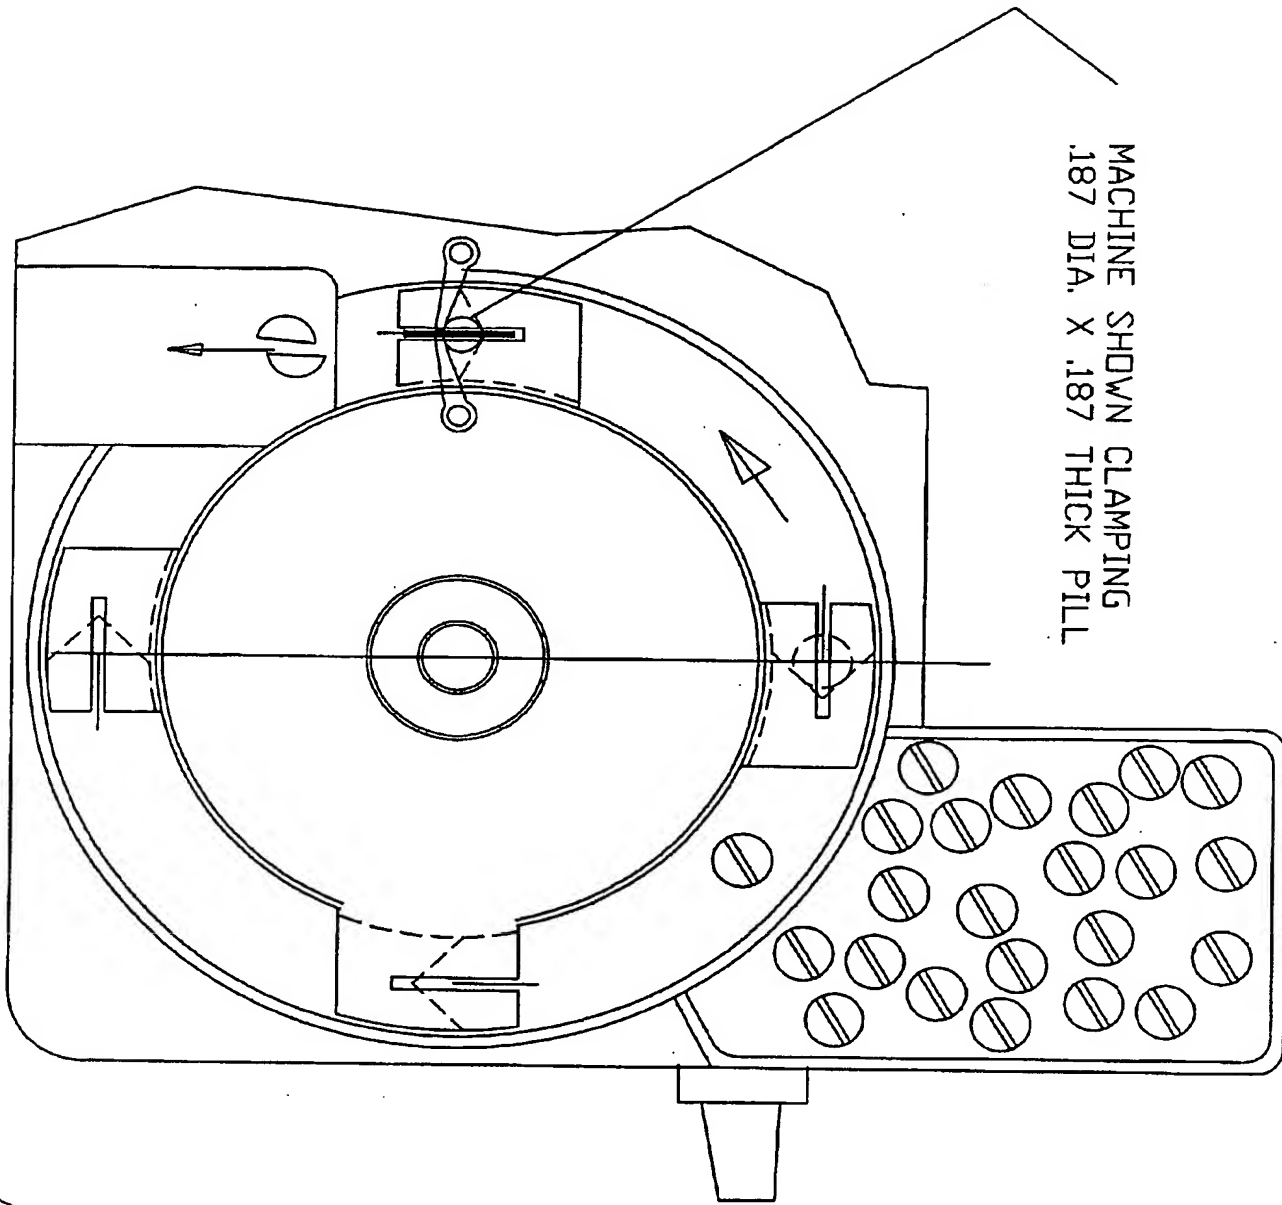

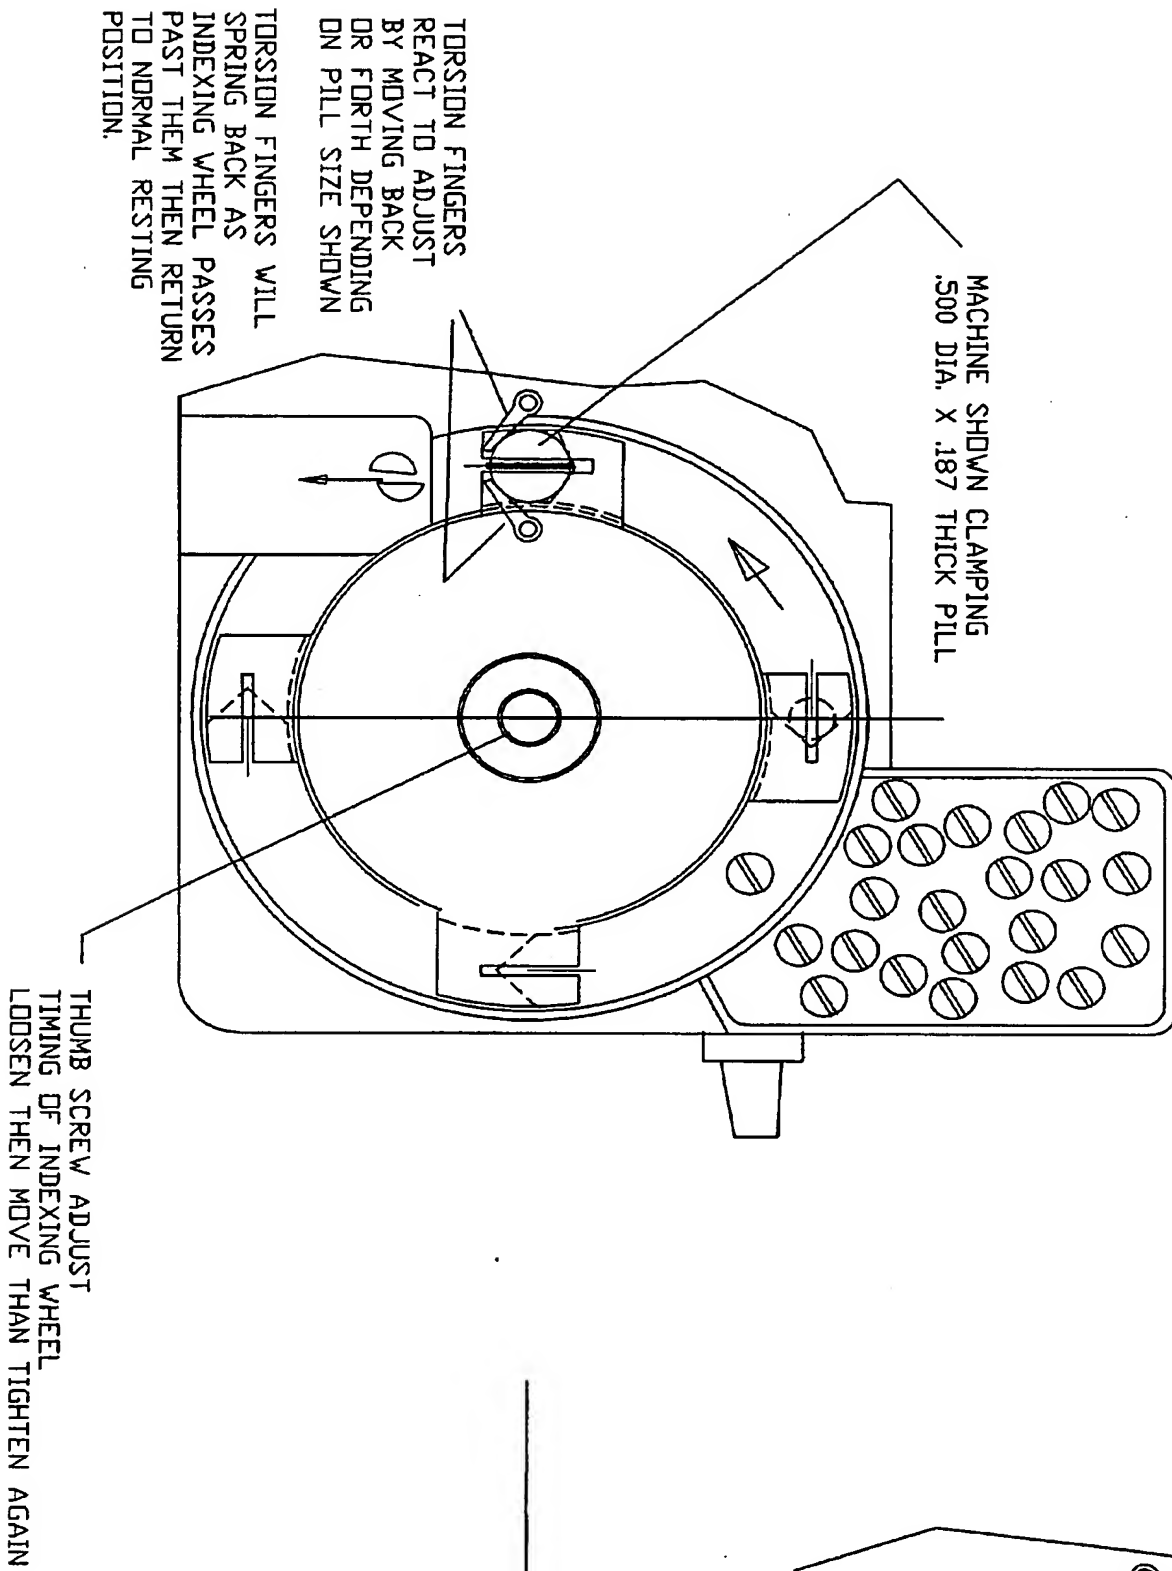

CLAIM #5 (RESPONSE)

ILLUSTRATES HOW THE INDEXING WHEEL HAS TO BE RETARDED OR ADVANCED DEPENDING ON PILL SIZE OF DIAMETER. INDEXING WHEEL IS RETARDED FOR LARGER DIAMETERS AND ADVANCED FOR SMALLER DIAMETERS AS SHOWN. TO MAKE THIS ADJUSTMENT JUST USE THUMB SCREW IN MIDDLE OF WHEEL LOOSEN TO MAKE BOTH ADJUSTMENTS THEN JUST TIGHTEN WHEN PILL IS CENTERED UNDER THE CUTTING BLADE

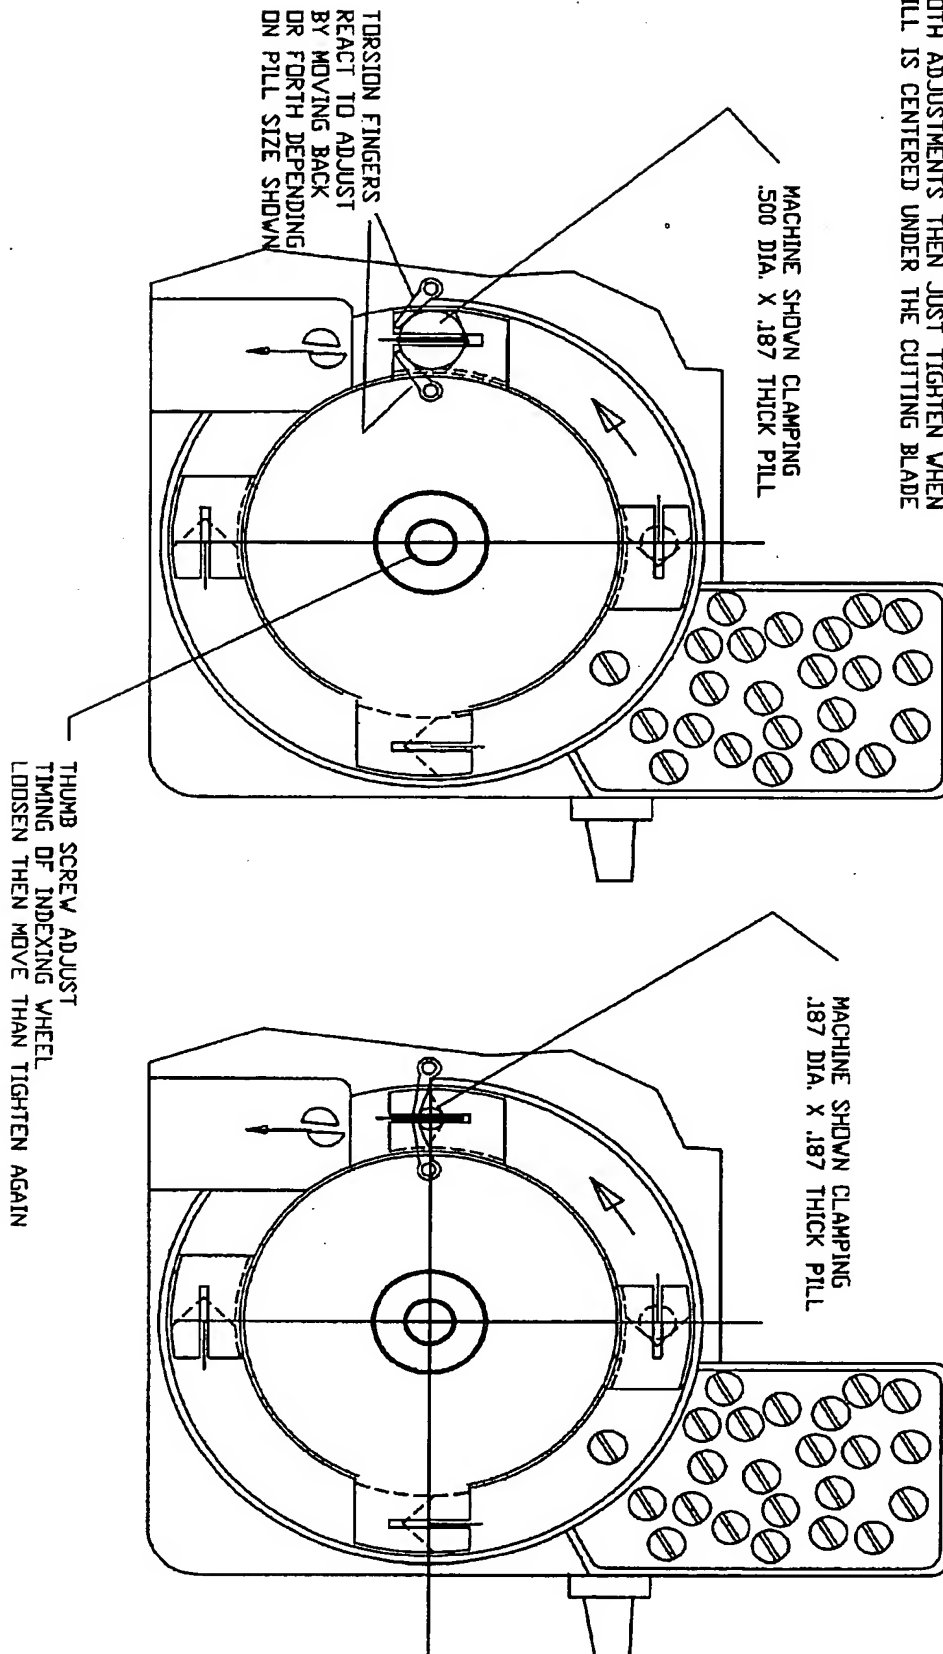

FAX RECEIVED

untitled

SEP 25 2006

OFFICE OF PETITIONS

Petitions for Revival office.

In response to application #10796490 i have sent in the petition for revival and power of attorney form because my patent attorney let my patent go abandoned unintentionally. I would like to add to my petition the response or action items that were needed by the examiner to see my serious intentions of continuing this patent application. You should have already recieved payment of 750.00.

If you have any more questions or concerns or anything else i need to do to keep this patent active please contact me asap.

Sincerely,

Mark A. Lykam
p.o. box 331
chelmsford, ma 01824

978 642 2094
408 427 1204
408 655 7253

ATT:

ANDREA SMITH


FROM

MARK LYKAM

978-642-2094

571-273-0025

CLAIM #1 (RESPONSE)

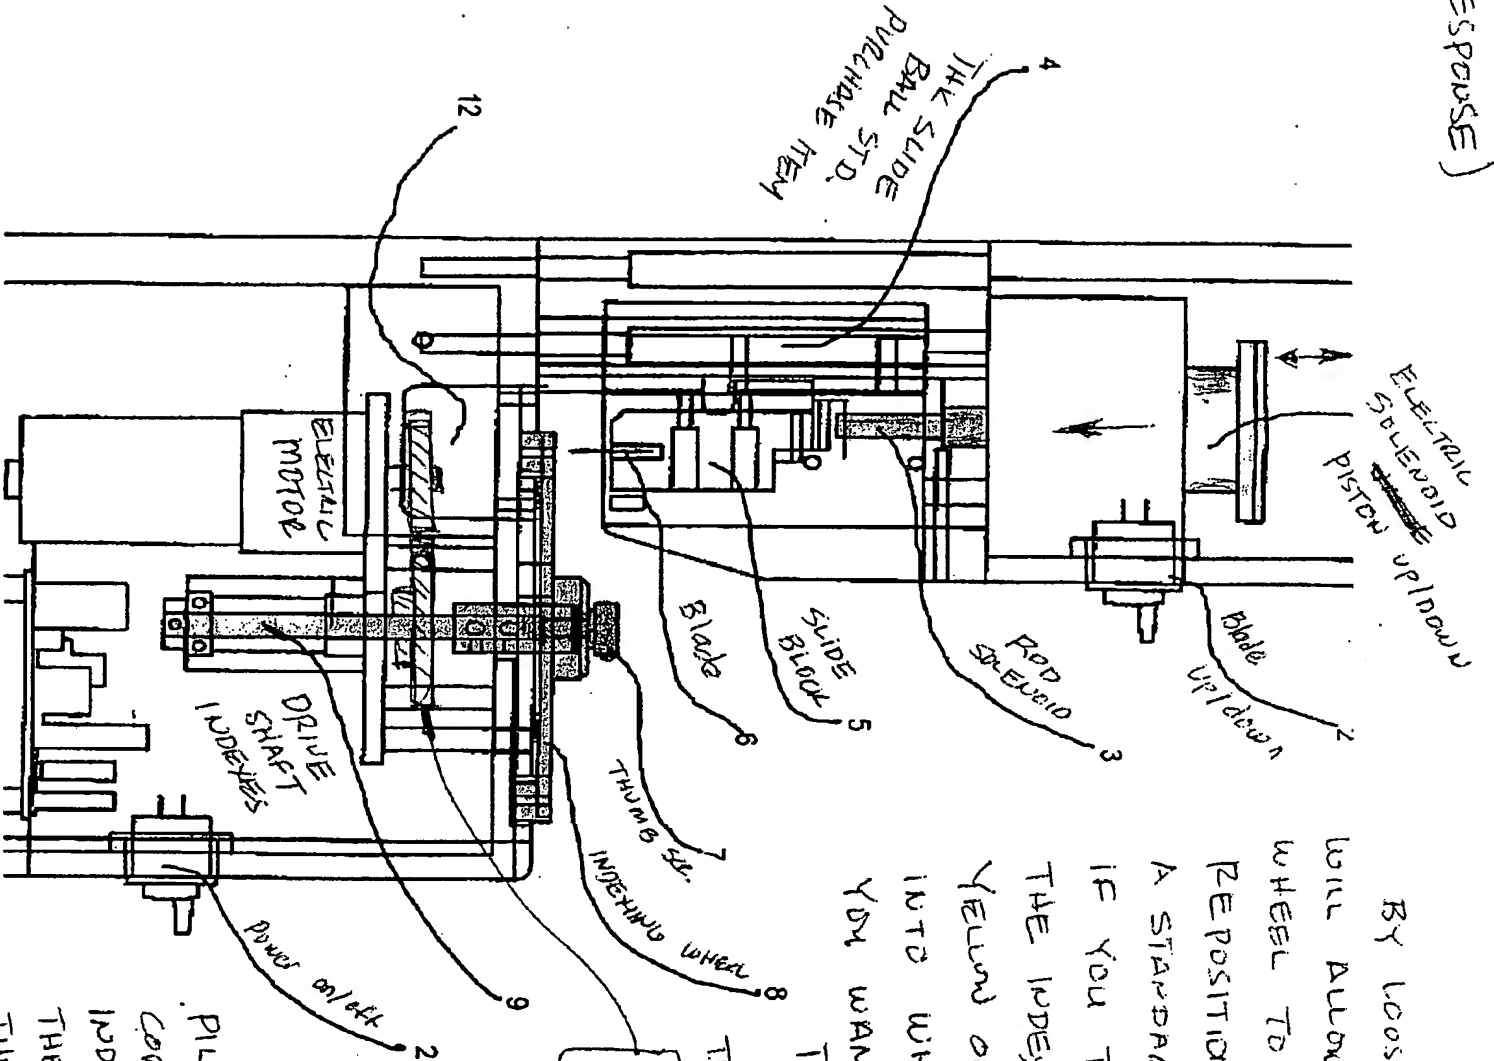

BY LOOSENING ITEM 7 THIS WILL ALLOW THE INDEXING WHEEL TO BE REMOVED OR REPOSITIONED. ITEM 7 IS A STANDARD #8-32 THUMB SCREW. IF YOU TIGHTENED ITEM 7 THE INDEX WHEEL COULD BE YELLOW OR ITEM 2 WILL LOCK INTO WHATEVER POSITION YOU WANT TO ROTATE IT TO. THIS ALLOWS YOU TO RETARD OR ADVANCE THE TIMING OF THE INDEXER

STP
GEAR
INDEXING MECHANISM
CIRCUIT

SELF CENTERING OF THE

PILL IS ACHIEVED BY

CORRECTLY SETTING UP THE

INDEXING WHEEL TO MATCH


THE DIAMETER OF THE PILL.

THE INDEXER BRINGS PILL

TO THE RIGHT POSITION &

CLAIM # 2 (RESPONSE)


NOTE: LH/RH TOPSIDO FINGERS []
 PURPOSE IS TO PUSH PILLS BACK INTO "V" GROOVE ON BOTTOM SIDE
 OF INDEXING WHEEL [] THIS LOCATES & CENTERS PILL FOR CUTTING.

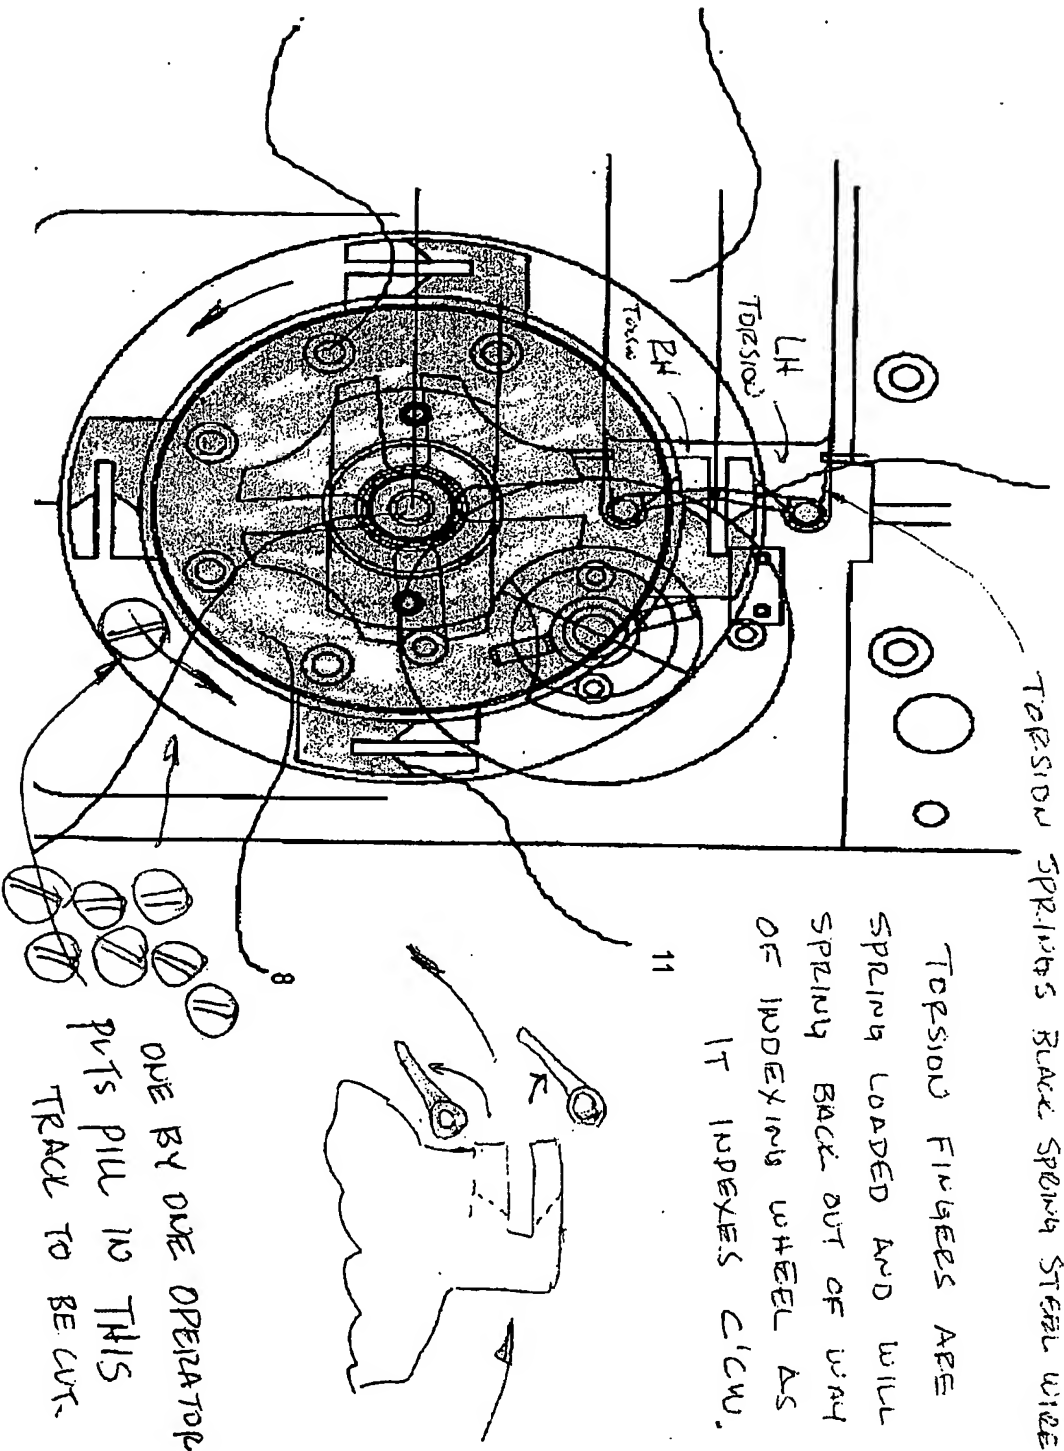

CODT.

INDEXING WHEEL [] ROTATES (INDEXES) BY GENEV MECHANISM &
 ELECTRIC MOTOR WHICH IS LOCATED AT BOTTOM SIDE OF INDEXING WHEEL.
 INDEXING WHEEL TRAVELS COUNTER CLOCKWISE & A RATE OF OVER


CLAIM # 3 (RESPONSE)
SHEET 1 ILLUSTRATION

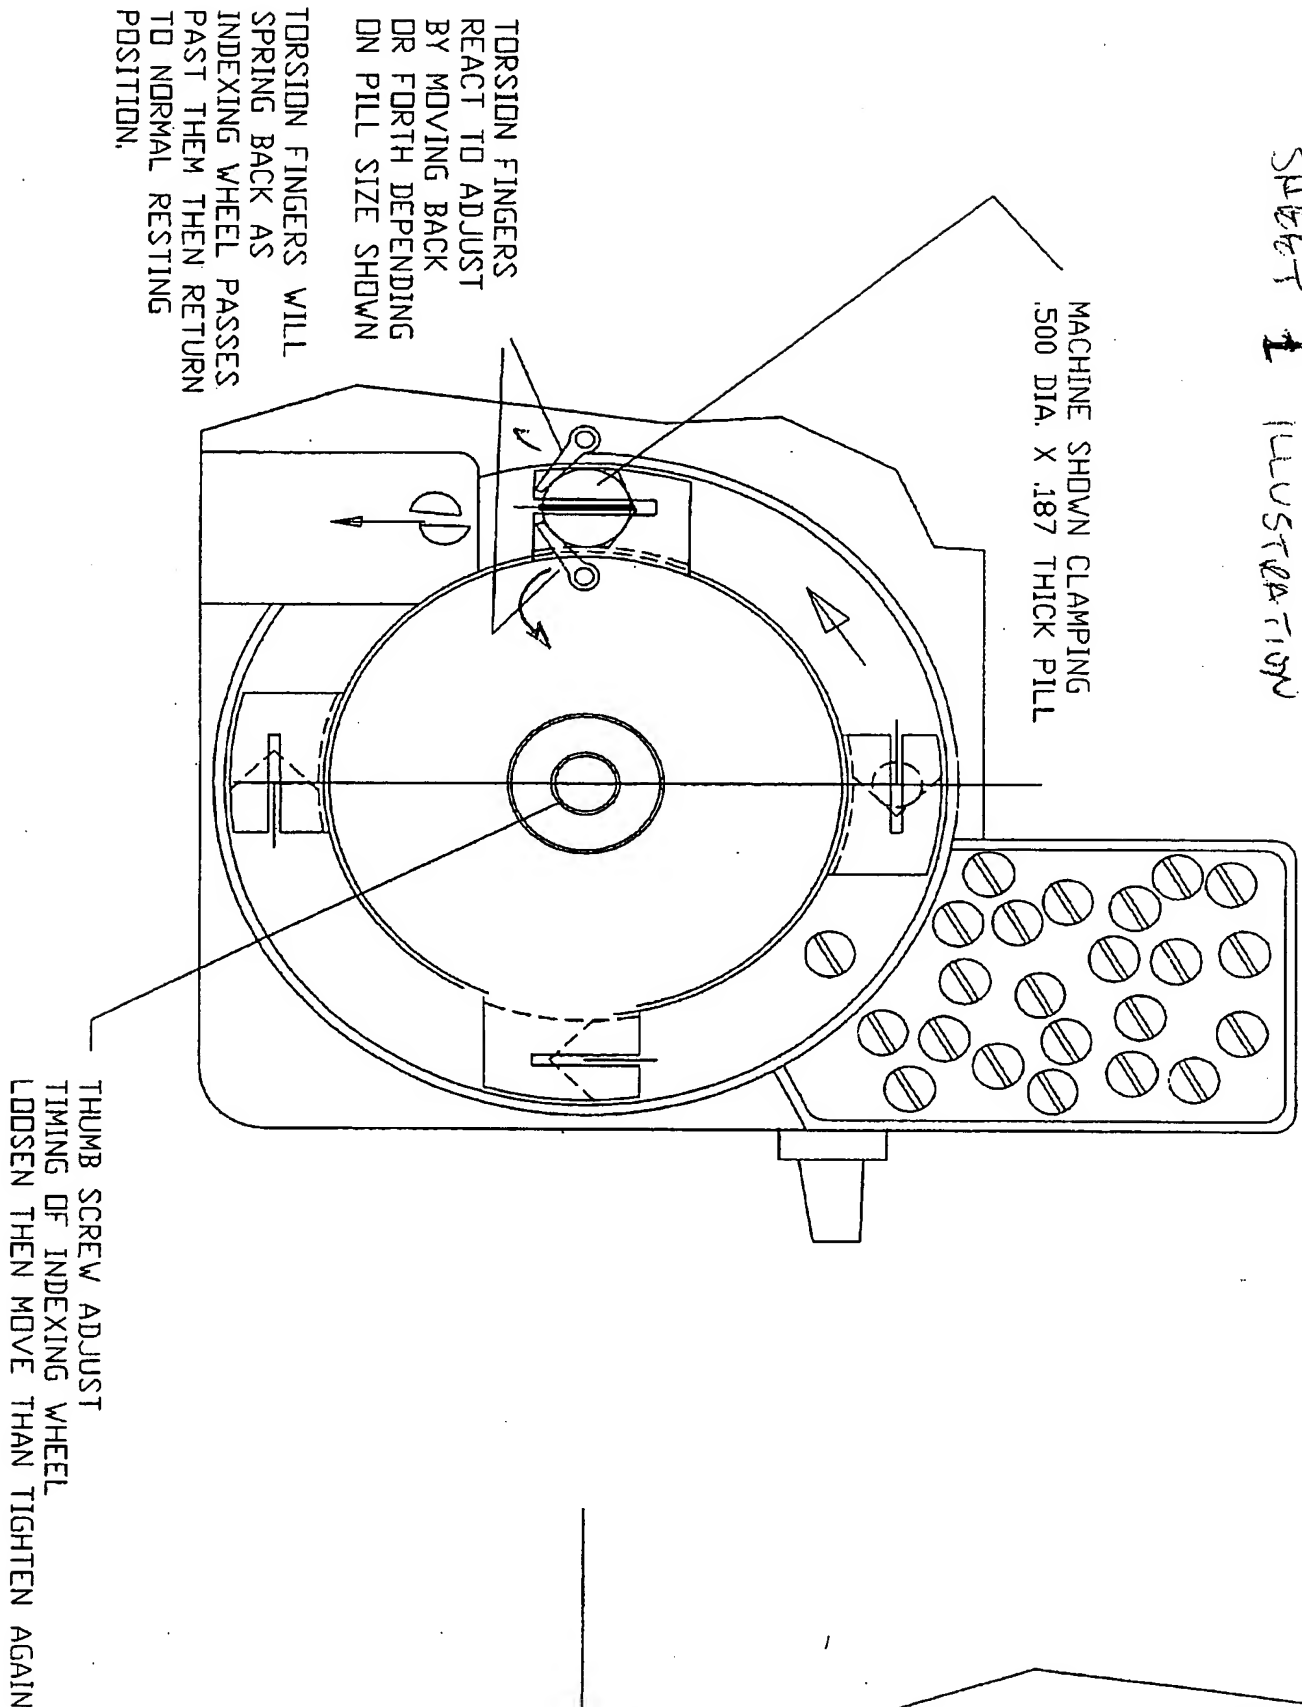

CLAIM #3 (RESPONSE)


SHEET #2

THE INDEXING WHEEL PASSES IN THE PATH OF THE LH/RH TORSION FINGER & AUTOMATICALLY PUSHES TORSION FINGER BACK OUT OF THE WAY ALLOWING INDEXING WHEEL TO CONTINUE TO ROTATE THROUGH IT. THIS ALLOWS THE PILL TO CONTINUE THRU THE MACHINE AFTER IT IS CUT IN HALF

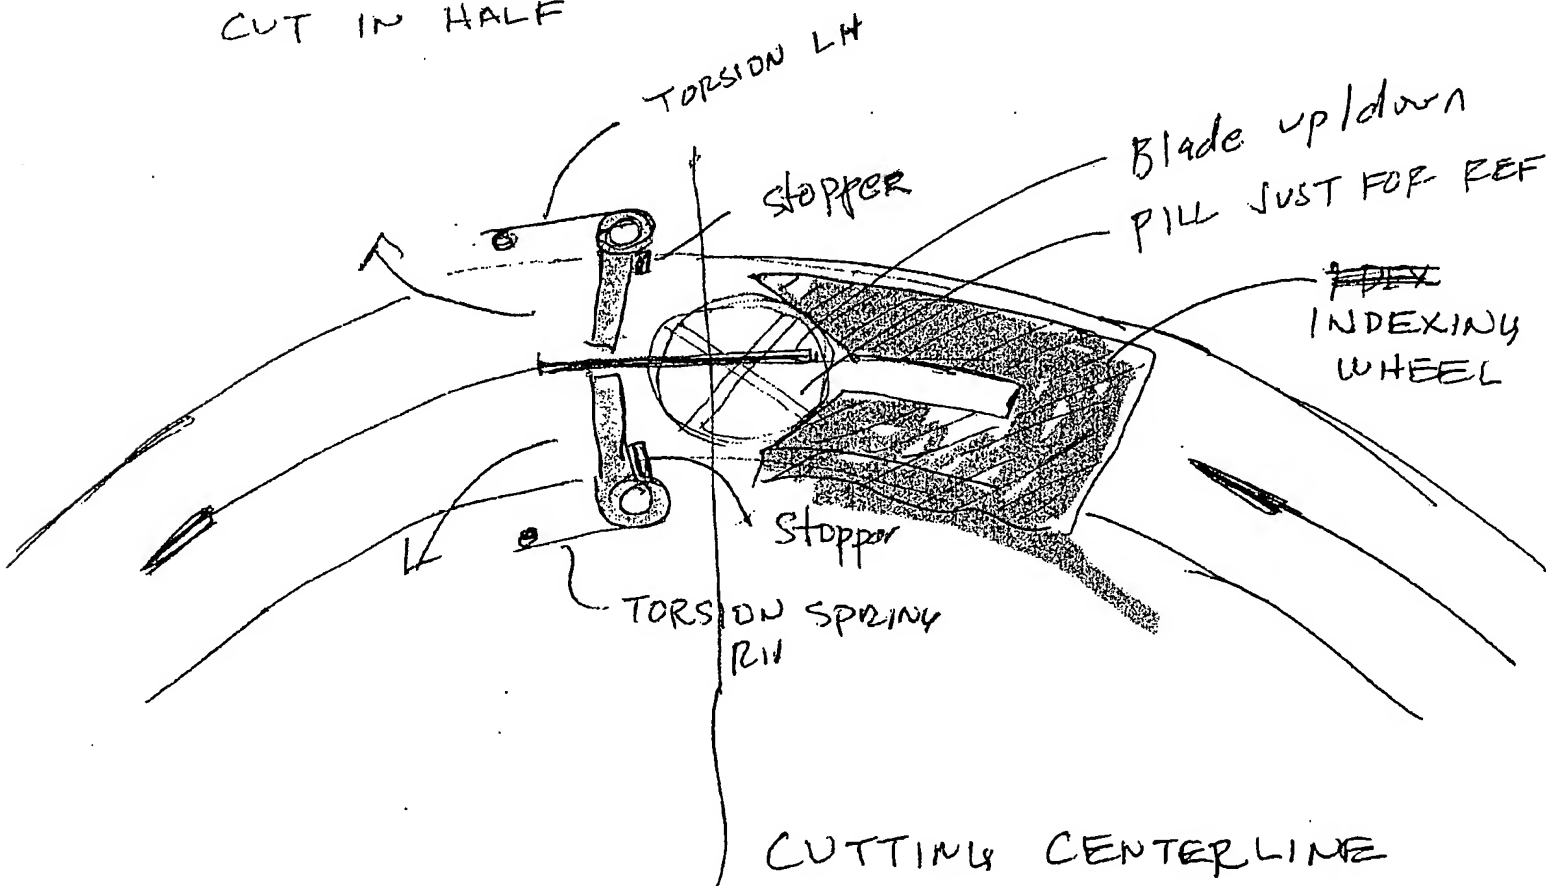

CLAIM # 4 (RESPONSE)

OPERATOR SLIDES ONE PILL INTO PILL TRACK AT ~~EACH~~ EACH INDEXING SEQUENCE. THE INDEXING WHEEL INDEXES AND MAKES CONTACT WITH PILL. THE PILL FALLS BACK INTO "V" GROOVE SHOWN ON BOTTOM SIDE IN HIDDEN LINES. THE INDEXER MOVES PILL TO CUTTER POSITION. BECAUSE THE PILL IS UNDER THE PLASTIC INDEXING WHEEL & THE ENABLE THE BLADE TO PASS THRU THE PILL AND COME BACK UP WITHOUT THE PILL COMING WITH THE BLA INDEXING WHEEL ACTS AS A STRIPPER PLATE AND POSITIONER.

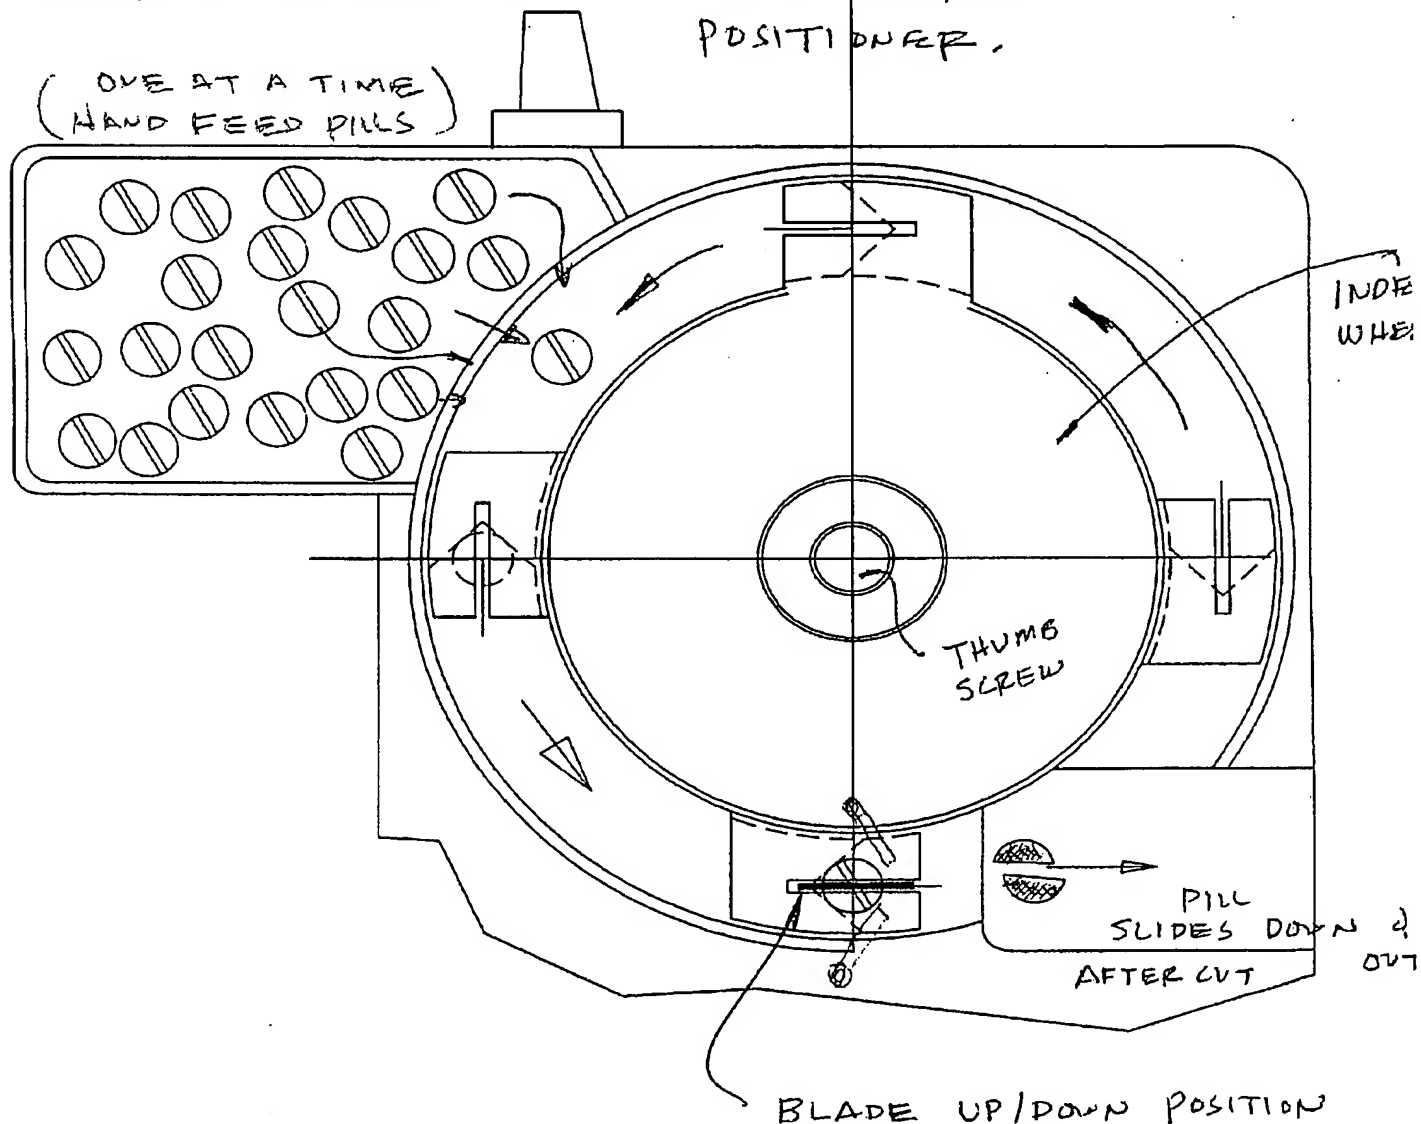


NOTE:

NO CHANGE OVER REQUIRED
SMALLER WHEEL


MACHINE SHOWN CLAMPING
.500 DIA. X .187 THICK PILL

TORSION FINGERS
REACT TO ADJUST
BY MOVING BACK
OR FORTH DEPENDING
ON PILL SIZE SHOWN

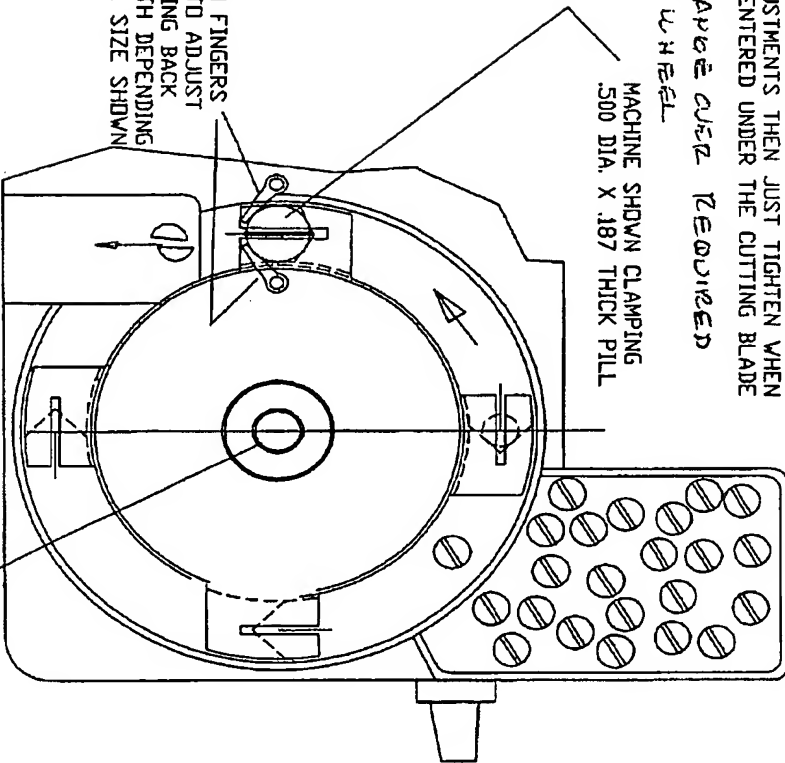


THUMB SCREW ADJUST
TIMING OF INDEXING WHEEL
LOOSEN THEN MOVE THAN TIGHTEN AGAIN

MACHINE SHOWN CLAMPING
.187 DIA. X .187 THICK PILL

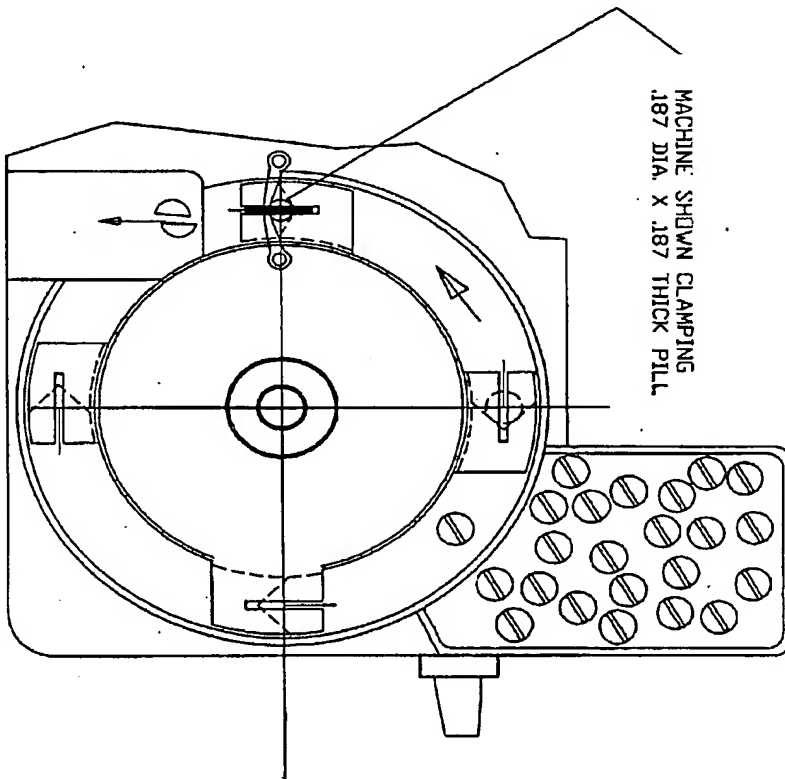

CLAIM #5 (RESPONSE)
ILLUSTRATIONS

THIS SHOWS INDEXING WHEEL
RECONFIGURED (MACHINED)
DIFFERENTLY THAN "Y" GROOVE
TO HANDLE OBLONG OVAL
SHAPED PILLS

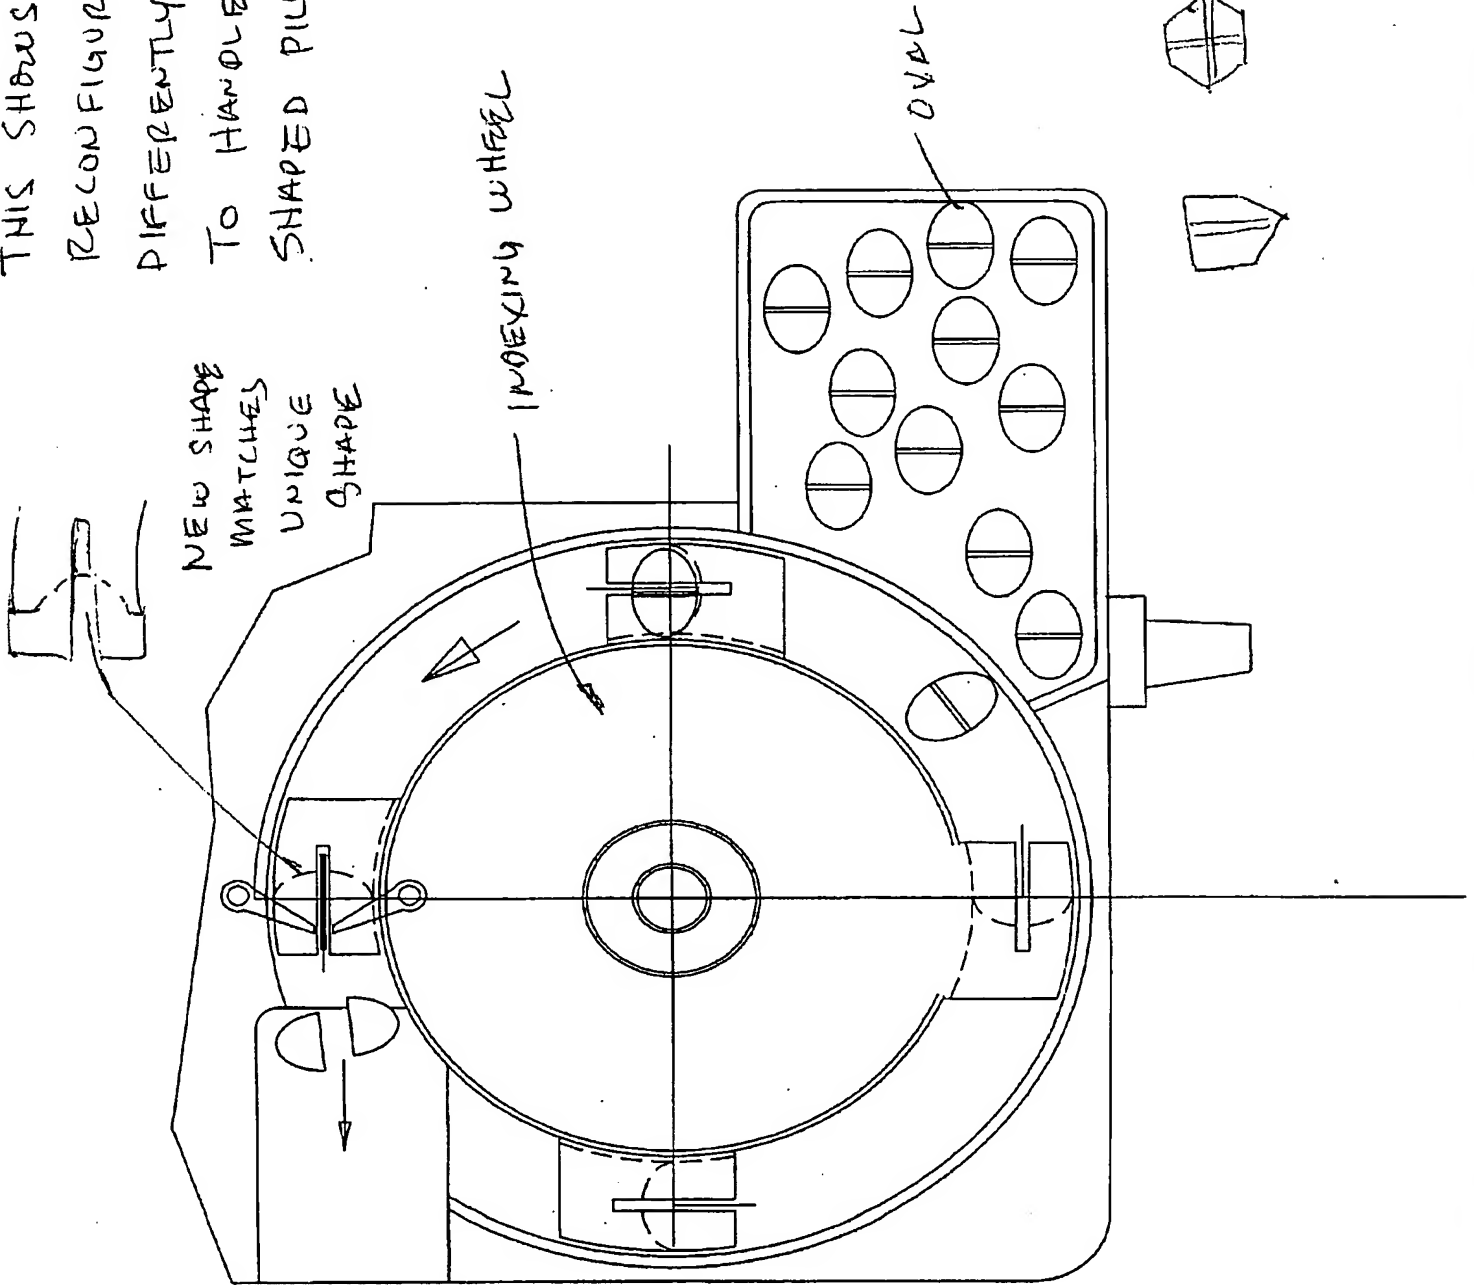

CLAIM # 7
(RESPONSE)

ELECTRIC CURRENT IS APPLIED TO SOLENOID ITEM #1 CAUSES PLUNGER TO MOVE DOWNWARD CREATING 16 POUNDS OF CUTTING FORCE. BLADE #6 ITEM IS ATTACHED TO A SPRING LOADED SLIDE #4 WHICH ALLOWS IT TO SPRING UPWARD AFTER SOLENOID IS DEGENERIZED OR POWER IS REVERSED.

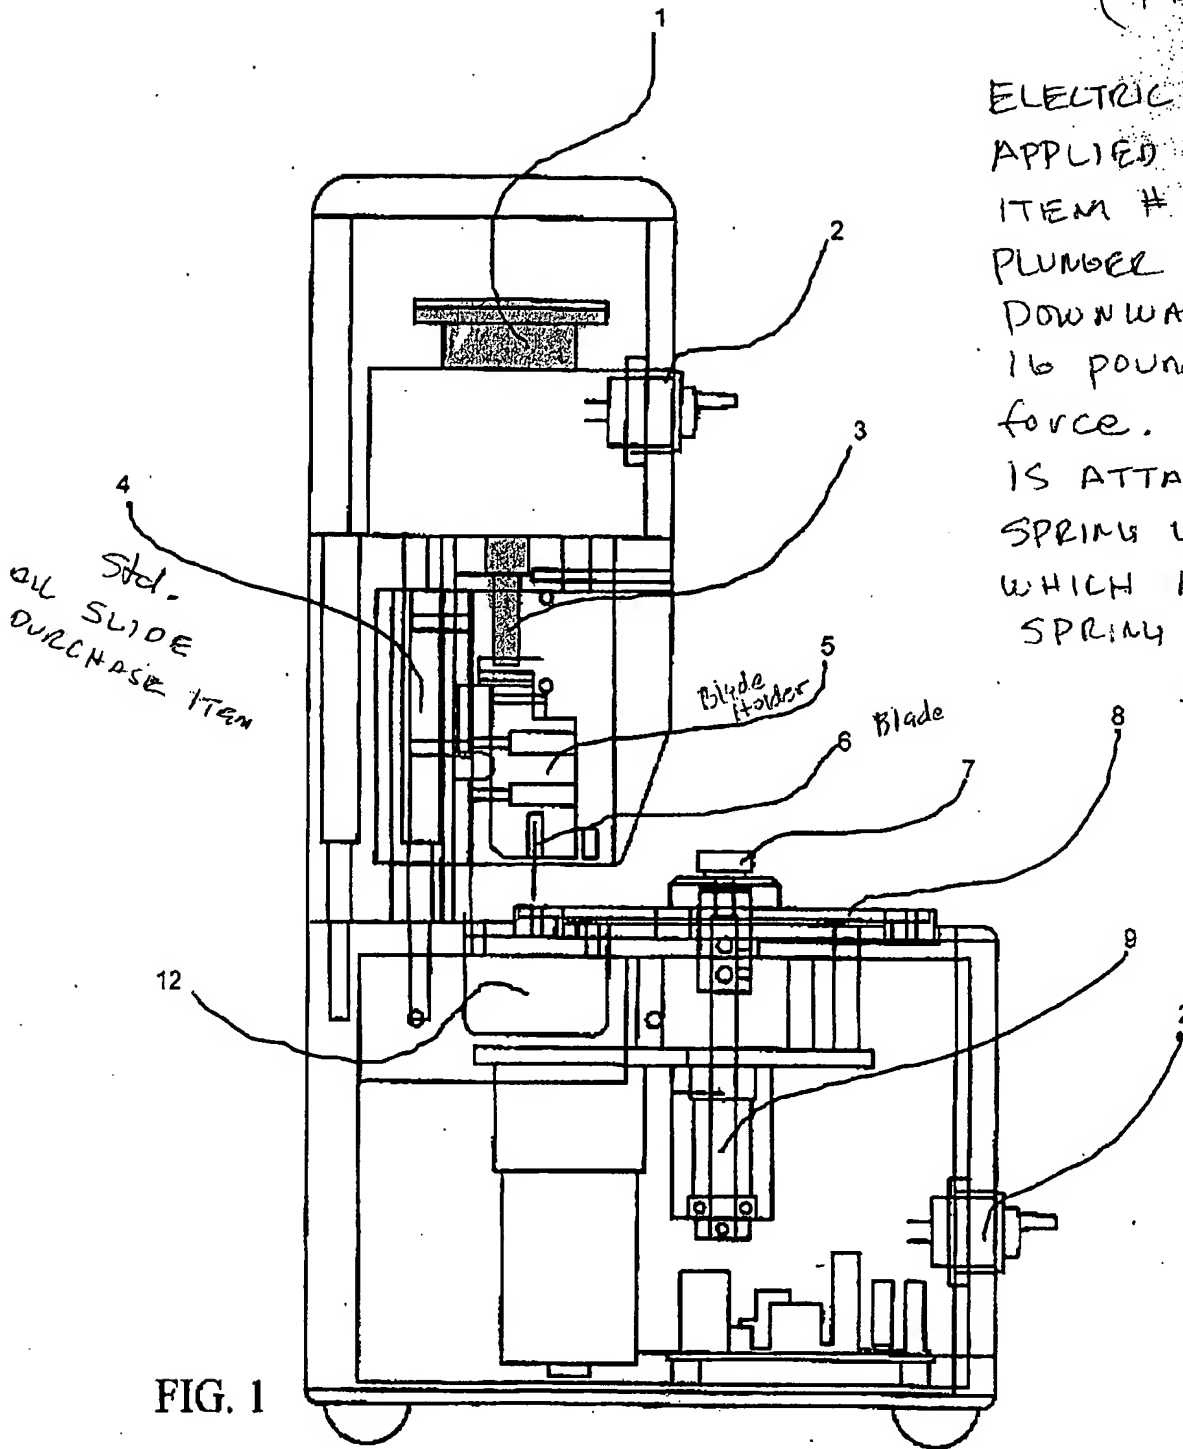


FIG. 1

CLAIM #8 (RESPONSE)

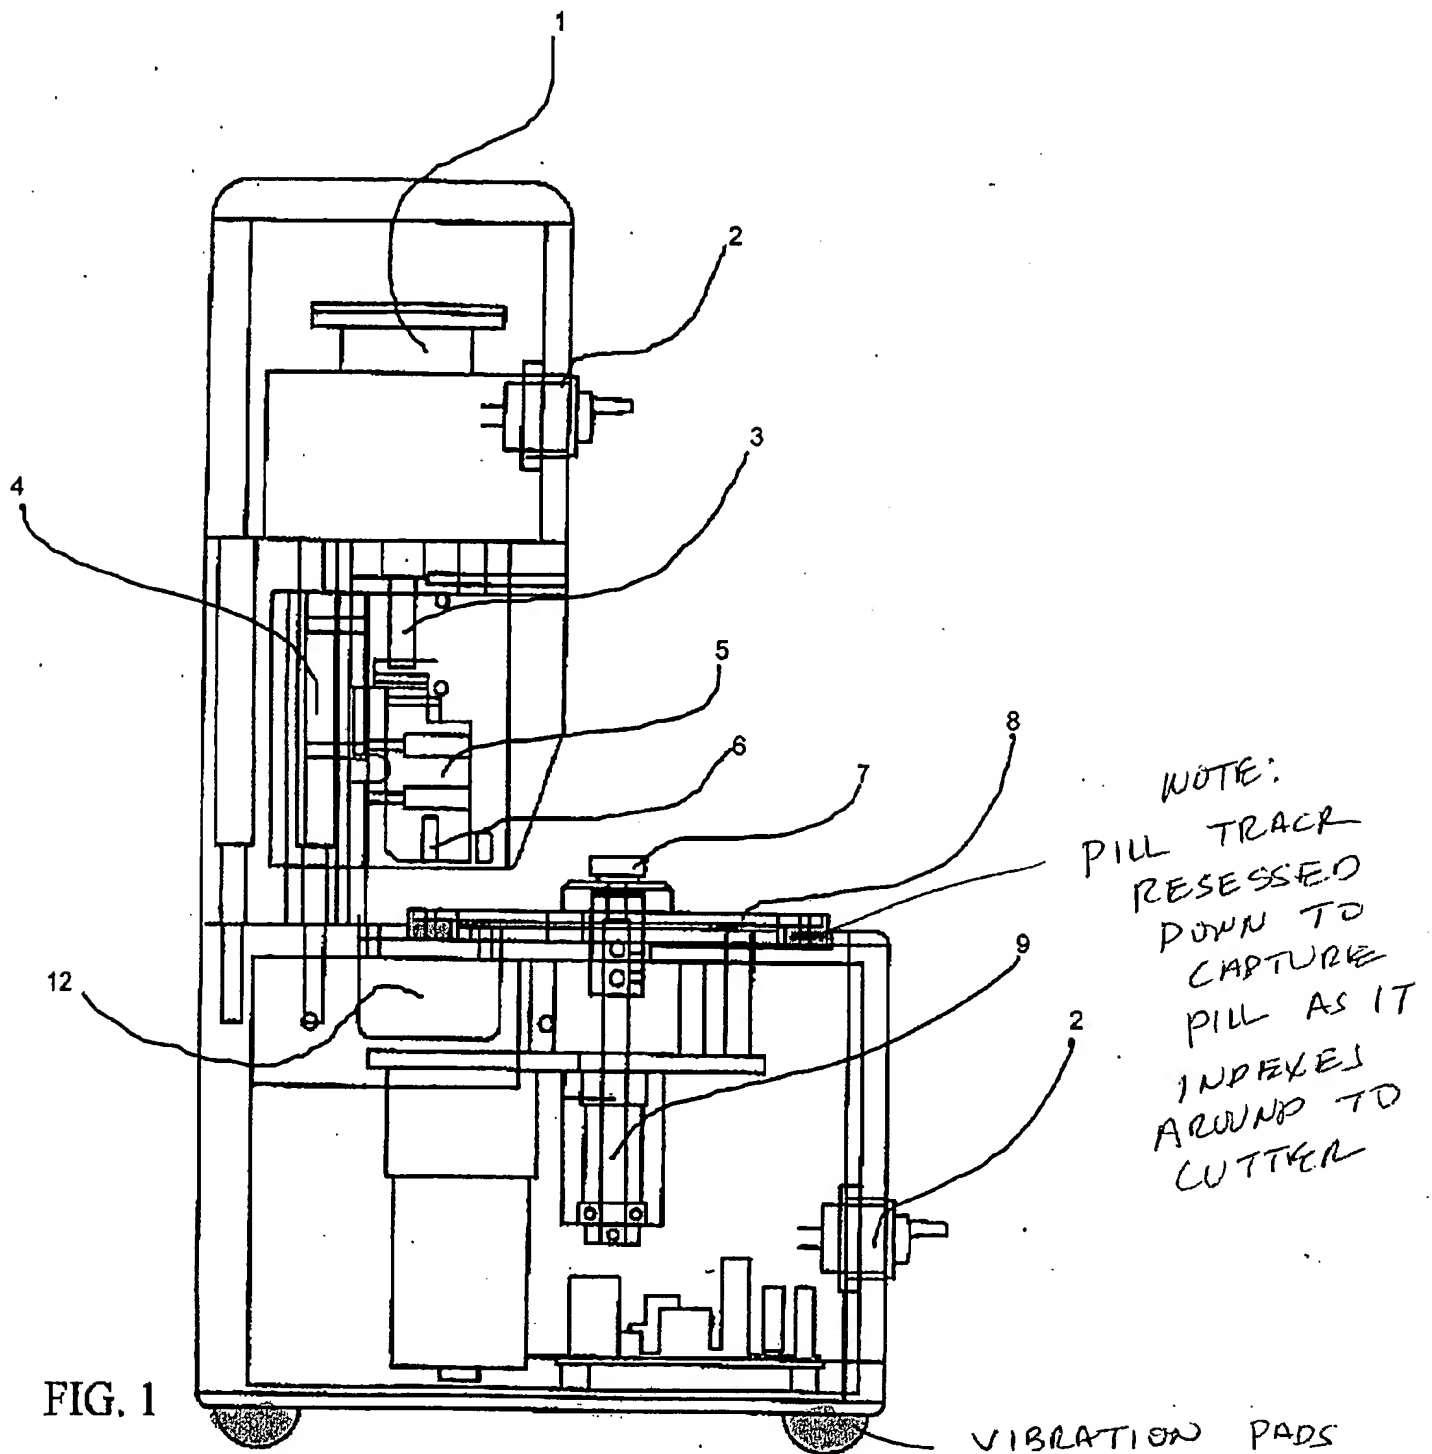
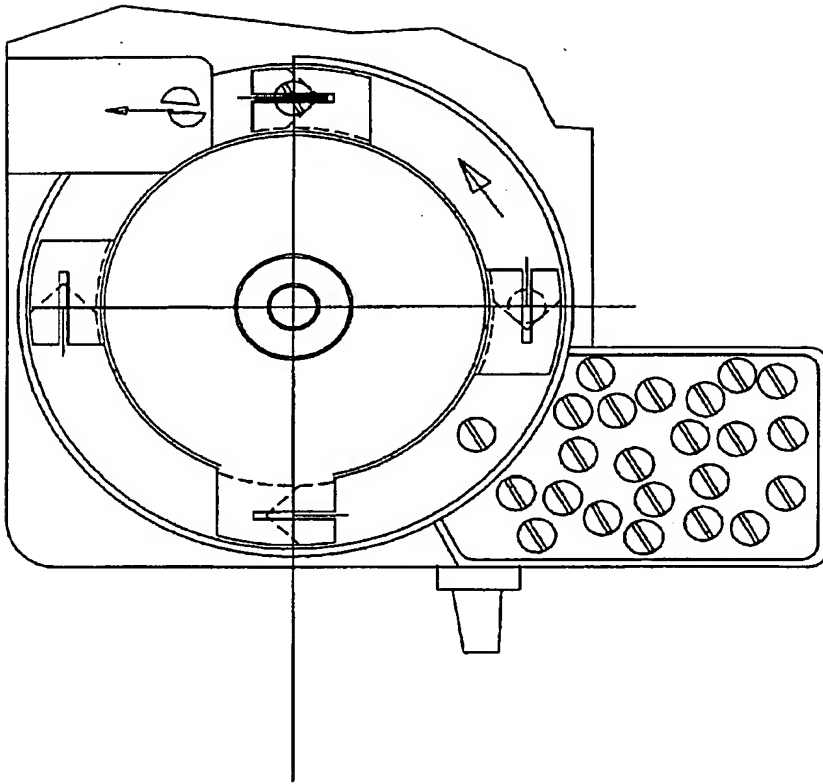


FIG. 1

WITHOUT VIBRATION PADS THE PILL WILL JUMP AROUND IN PILL TRACK AND POSSIBLY ROTATE TO MUCH TO BE CENTERED CORRECTLY AT CUTTING POSITION,




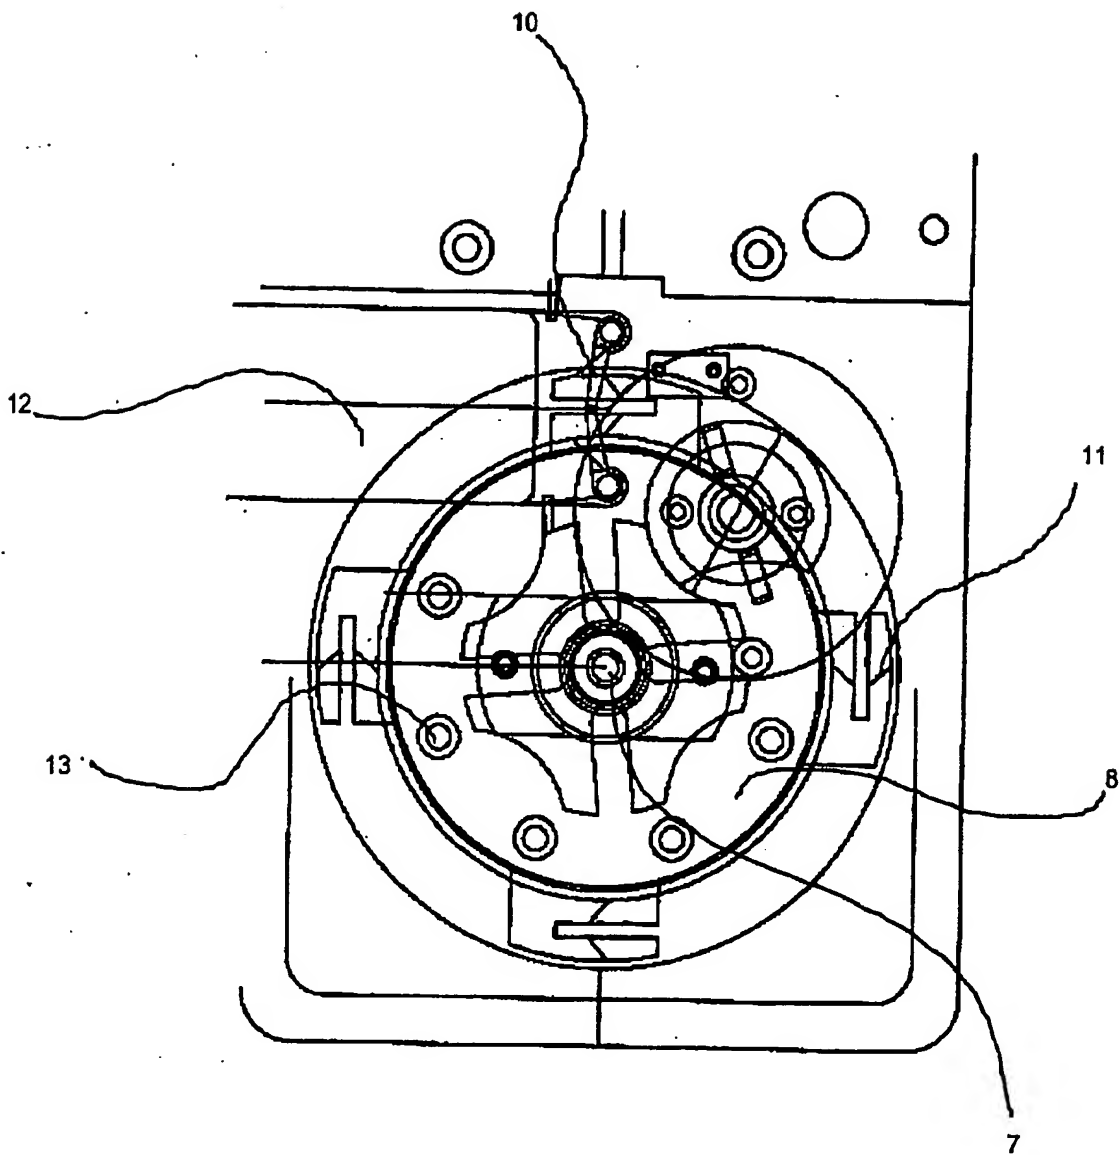



FIG. 2


CLAIM #5 (RESPONSE)


ILLUSTRATES HOW THE INDEXING WHEEL HAS TO BE RETARDED OR ADVANCED DEPENDING ON PILL SIZE OF DIAMETER. INDEXING WHEEL IS RETARDED FOR LARGER DIAMETERS AND ADVANCED FOR SMALLER DIAMETERS AS SHOWN. TO MAKE THIS ADJUSTMENT JUST USE THUMB SCREW IN MIDDLE OF WHEEL LOOSEN TO MAKE BOTH ADJUSTMENTS THEN JUST TIGHTEN WHEN PILL IS CENTERED UNDER THE CUTTING BLADE

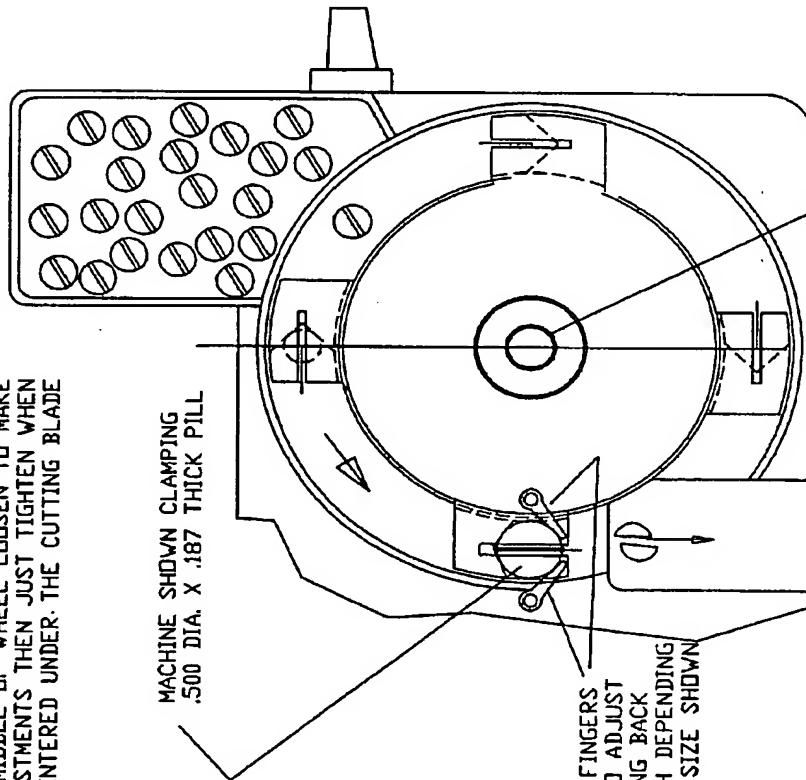

TORSION FINGERS REACT TO ADJUST BY MOVING BACK OR FORTH DEPENDING ON PILL SIZE SHOWN

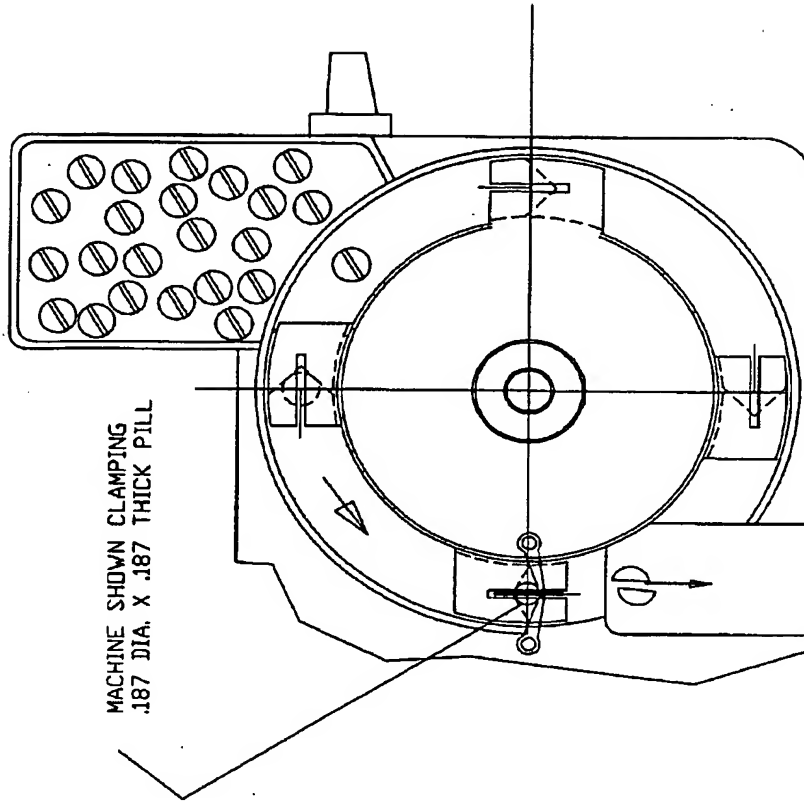

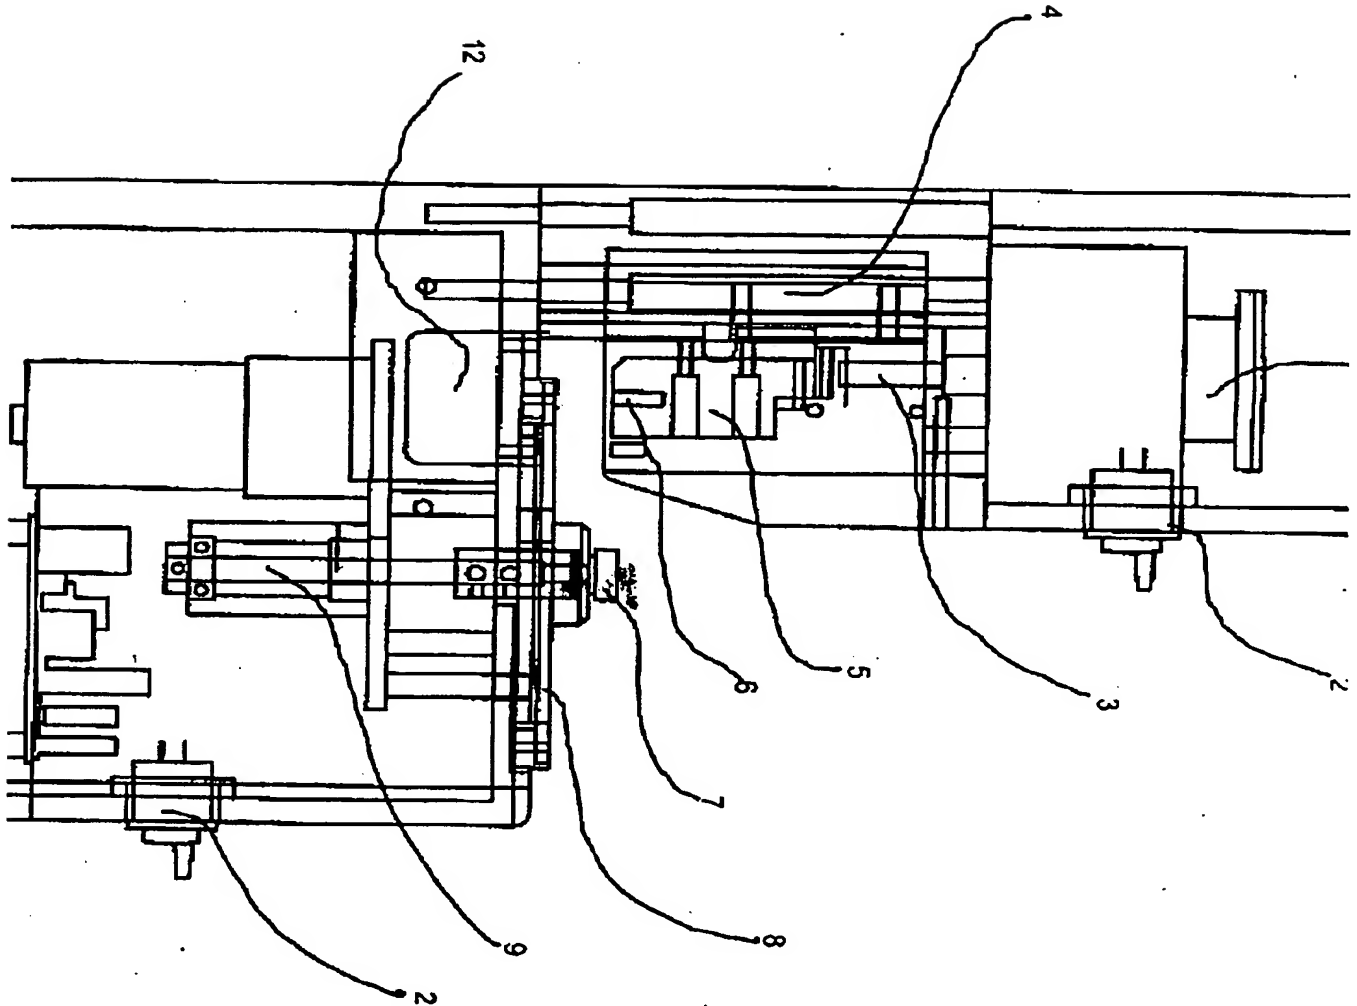

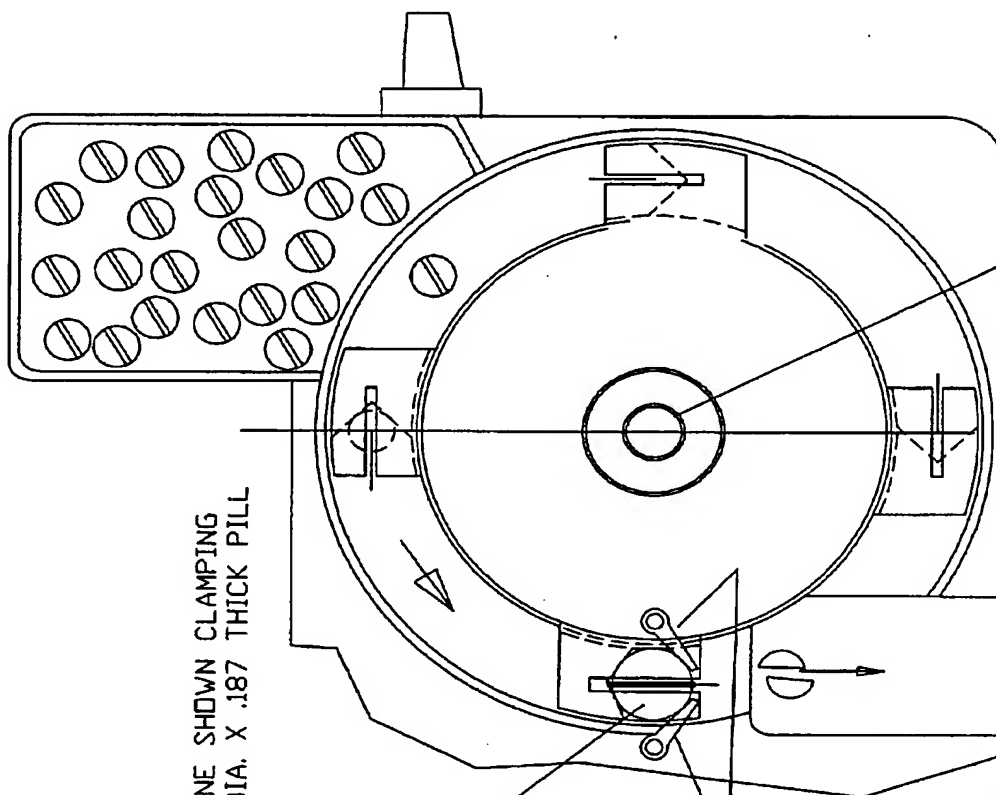


MACHINE SHOWN CLAMPING
.500 DIA. X .187 THICK PILL


TORSION FINGERS
REACT TO ADJUST
BY MOVING BACK
OR FORTH DEPENDING
ON PILL SIZE SHOWN


TORSION FINGERS WILL
SPRING BACK AS
INDEXING WHEEL PASSES
PAST THEM THEN RETURN
TO NORMAL RESTING
POSITION.

THUMB SCREW ADJUST
TIMING OF INDEXING WHEEL
LOOSEN THEN MOVE THAN TIGHTEN AGAIN

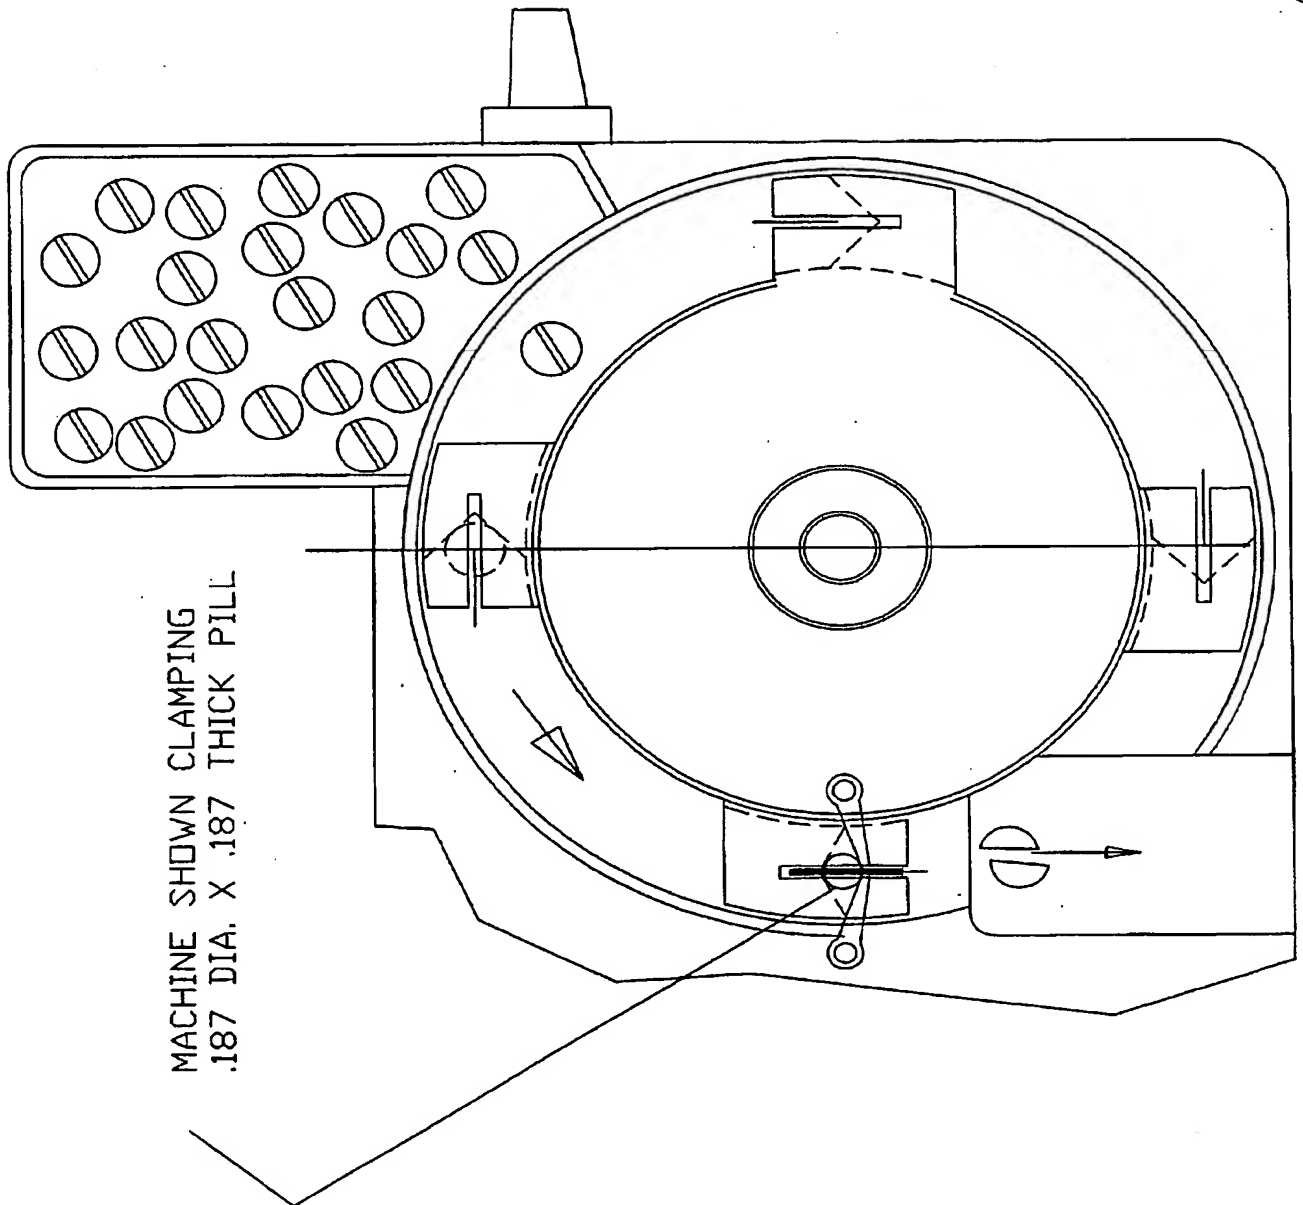

MACHINE SHOWN CLAMPING
.187 DIA. X .187 THICK PILL

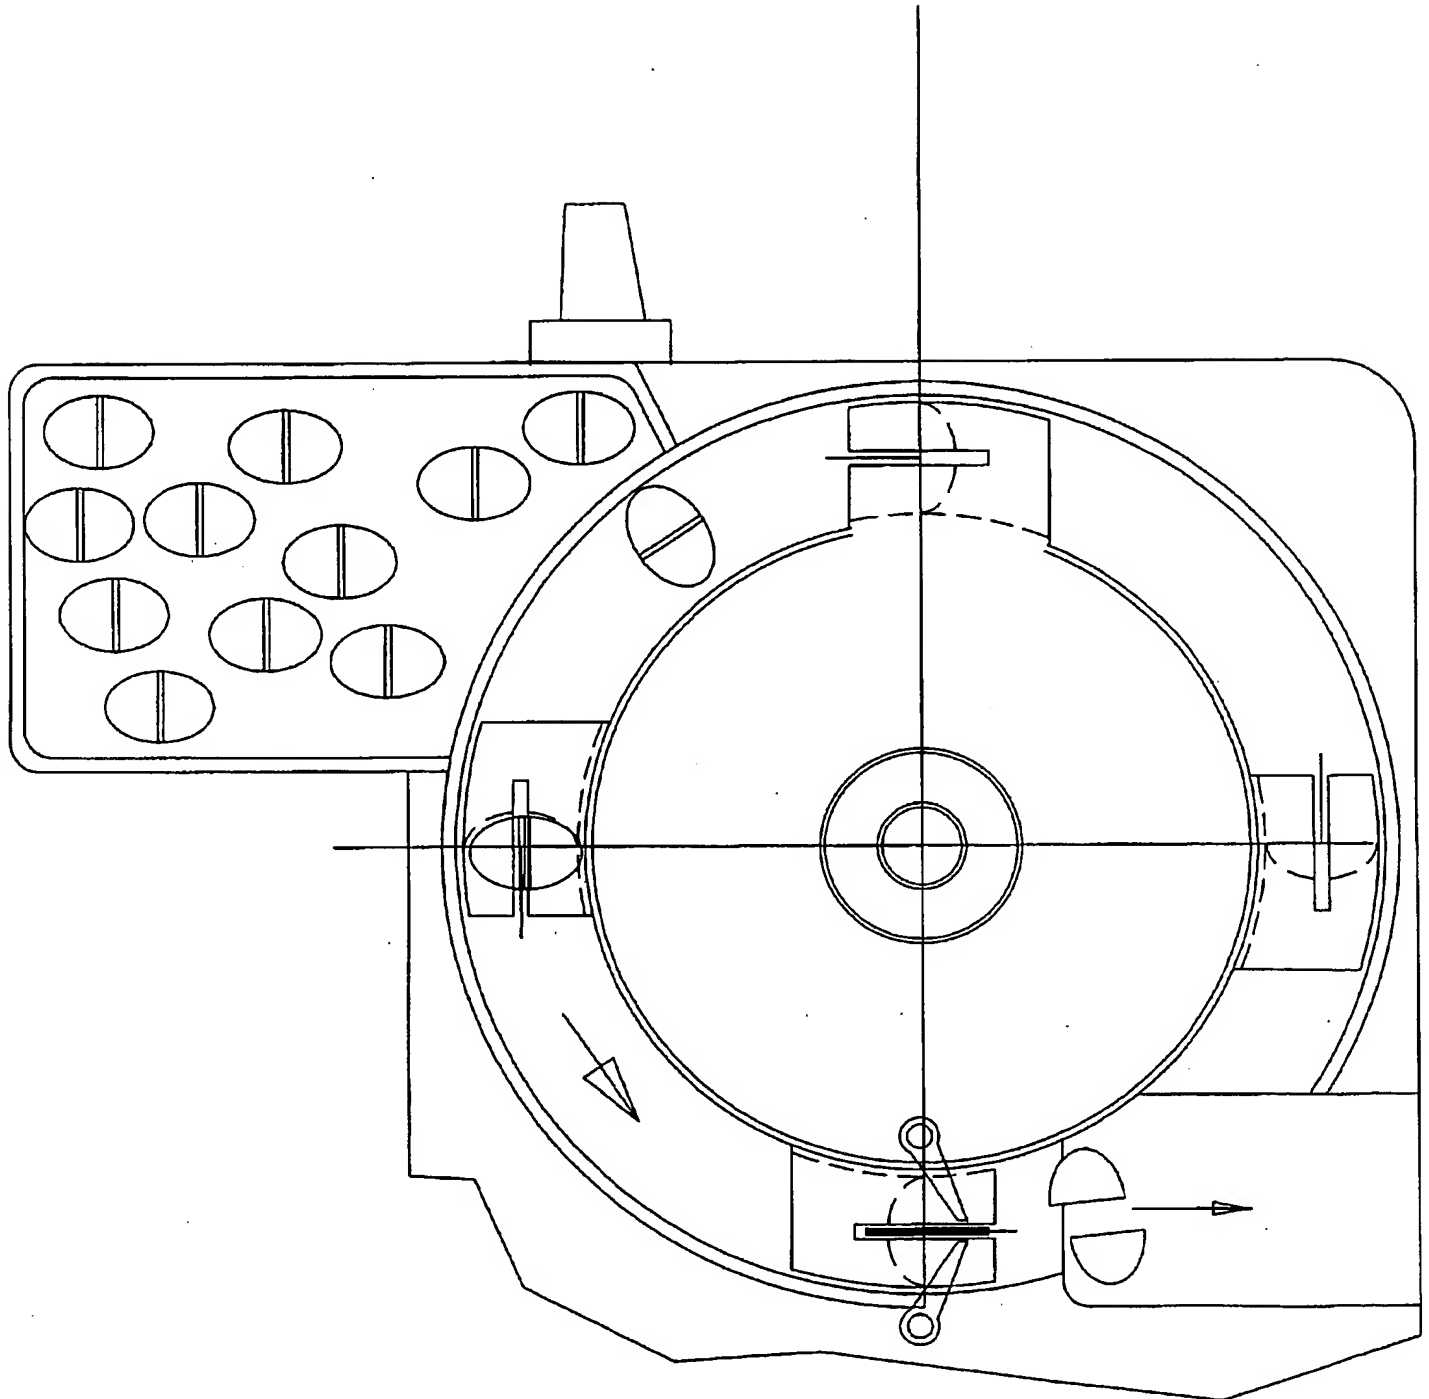

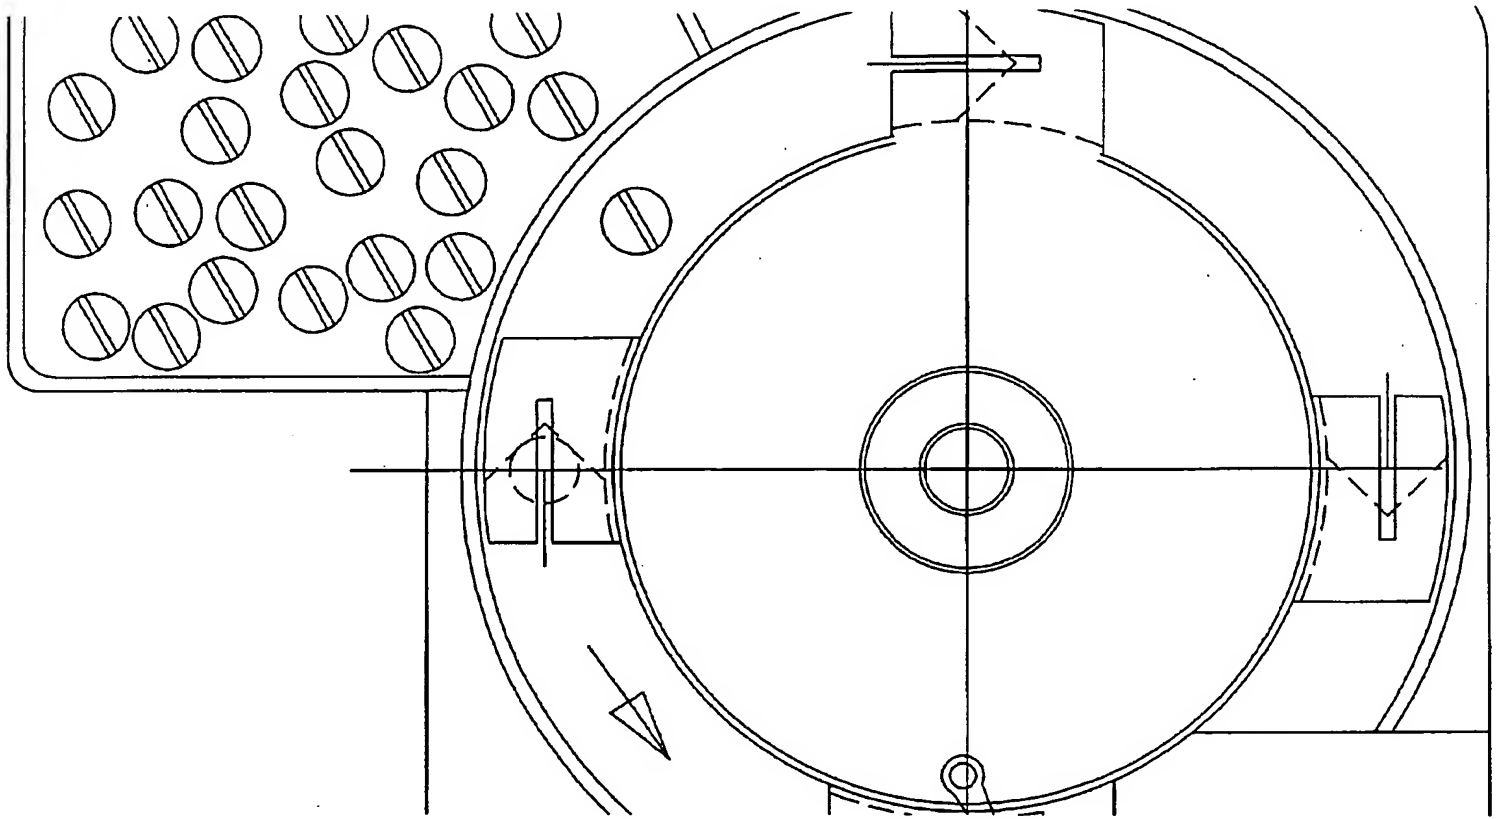

**This Page is Inserted by IFW Indexing and Scanning
Operations and is not part of the Official Record**

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

- ☐ BLACK BORDERS
- ☐ IMAGE CUT OFF AT TOP, BOTTOM OR SIDES
- ☐ FADED TEXT OR DRAWING
- ☐ BLURRED OR ILLEGIBLE TEXT OR DRAWING
- ☐ SKEWED/SLANTED IMAGES
- ☐ COLOR OR BLACK AND WHITE PHOTOGRAPHS
- ☐ GRAY SCALE DOCUMENTS
- ☒ LINES OR MARKS ON ORIGINAL DOCUMENT
- ☐ REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY
- ☐ OTHER: _____

IMAGES ARE BEST AVAILABLE COPY.

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.